


# G40-KT-020-A

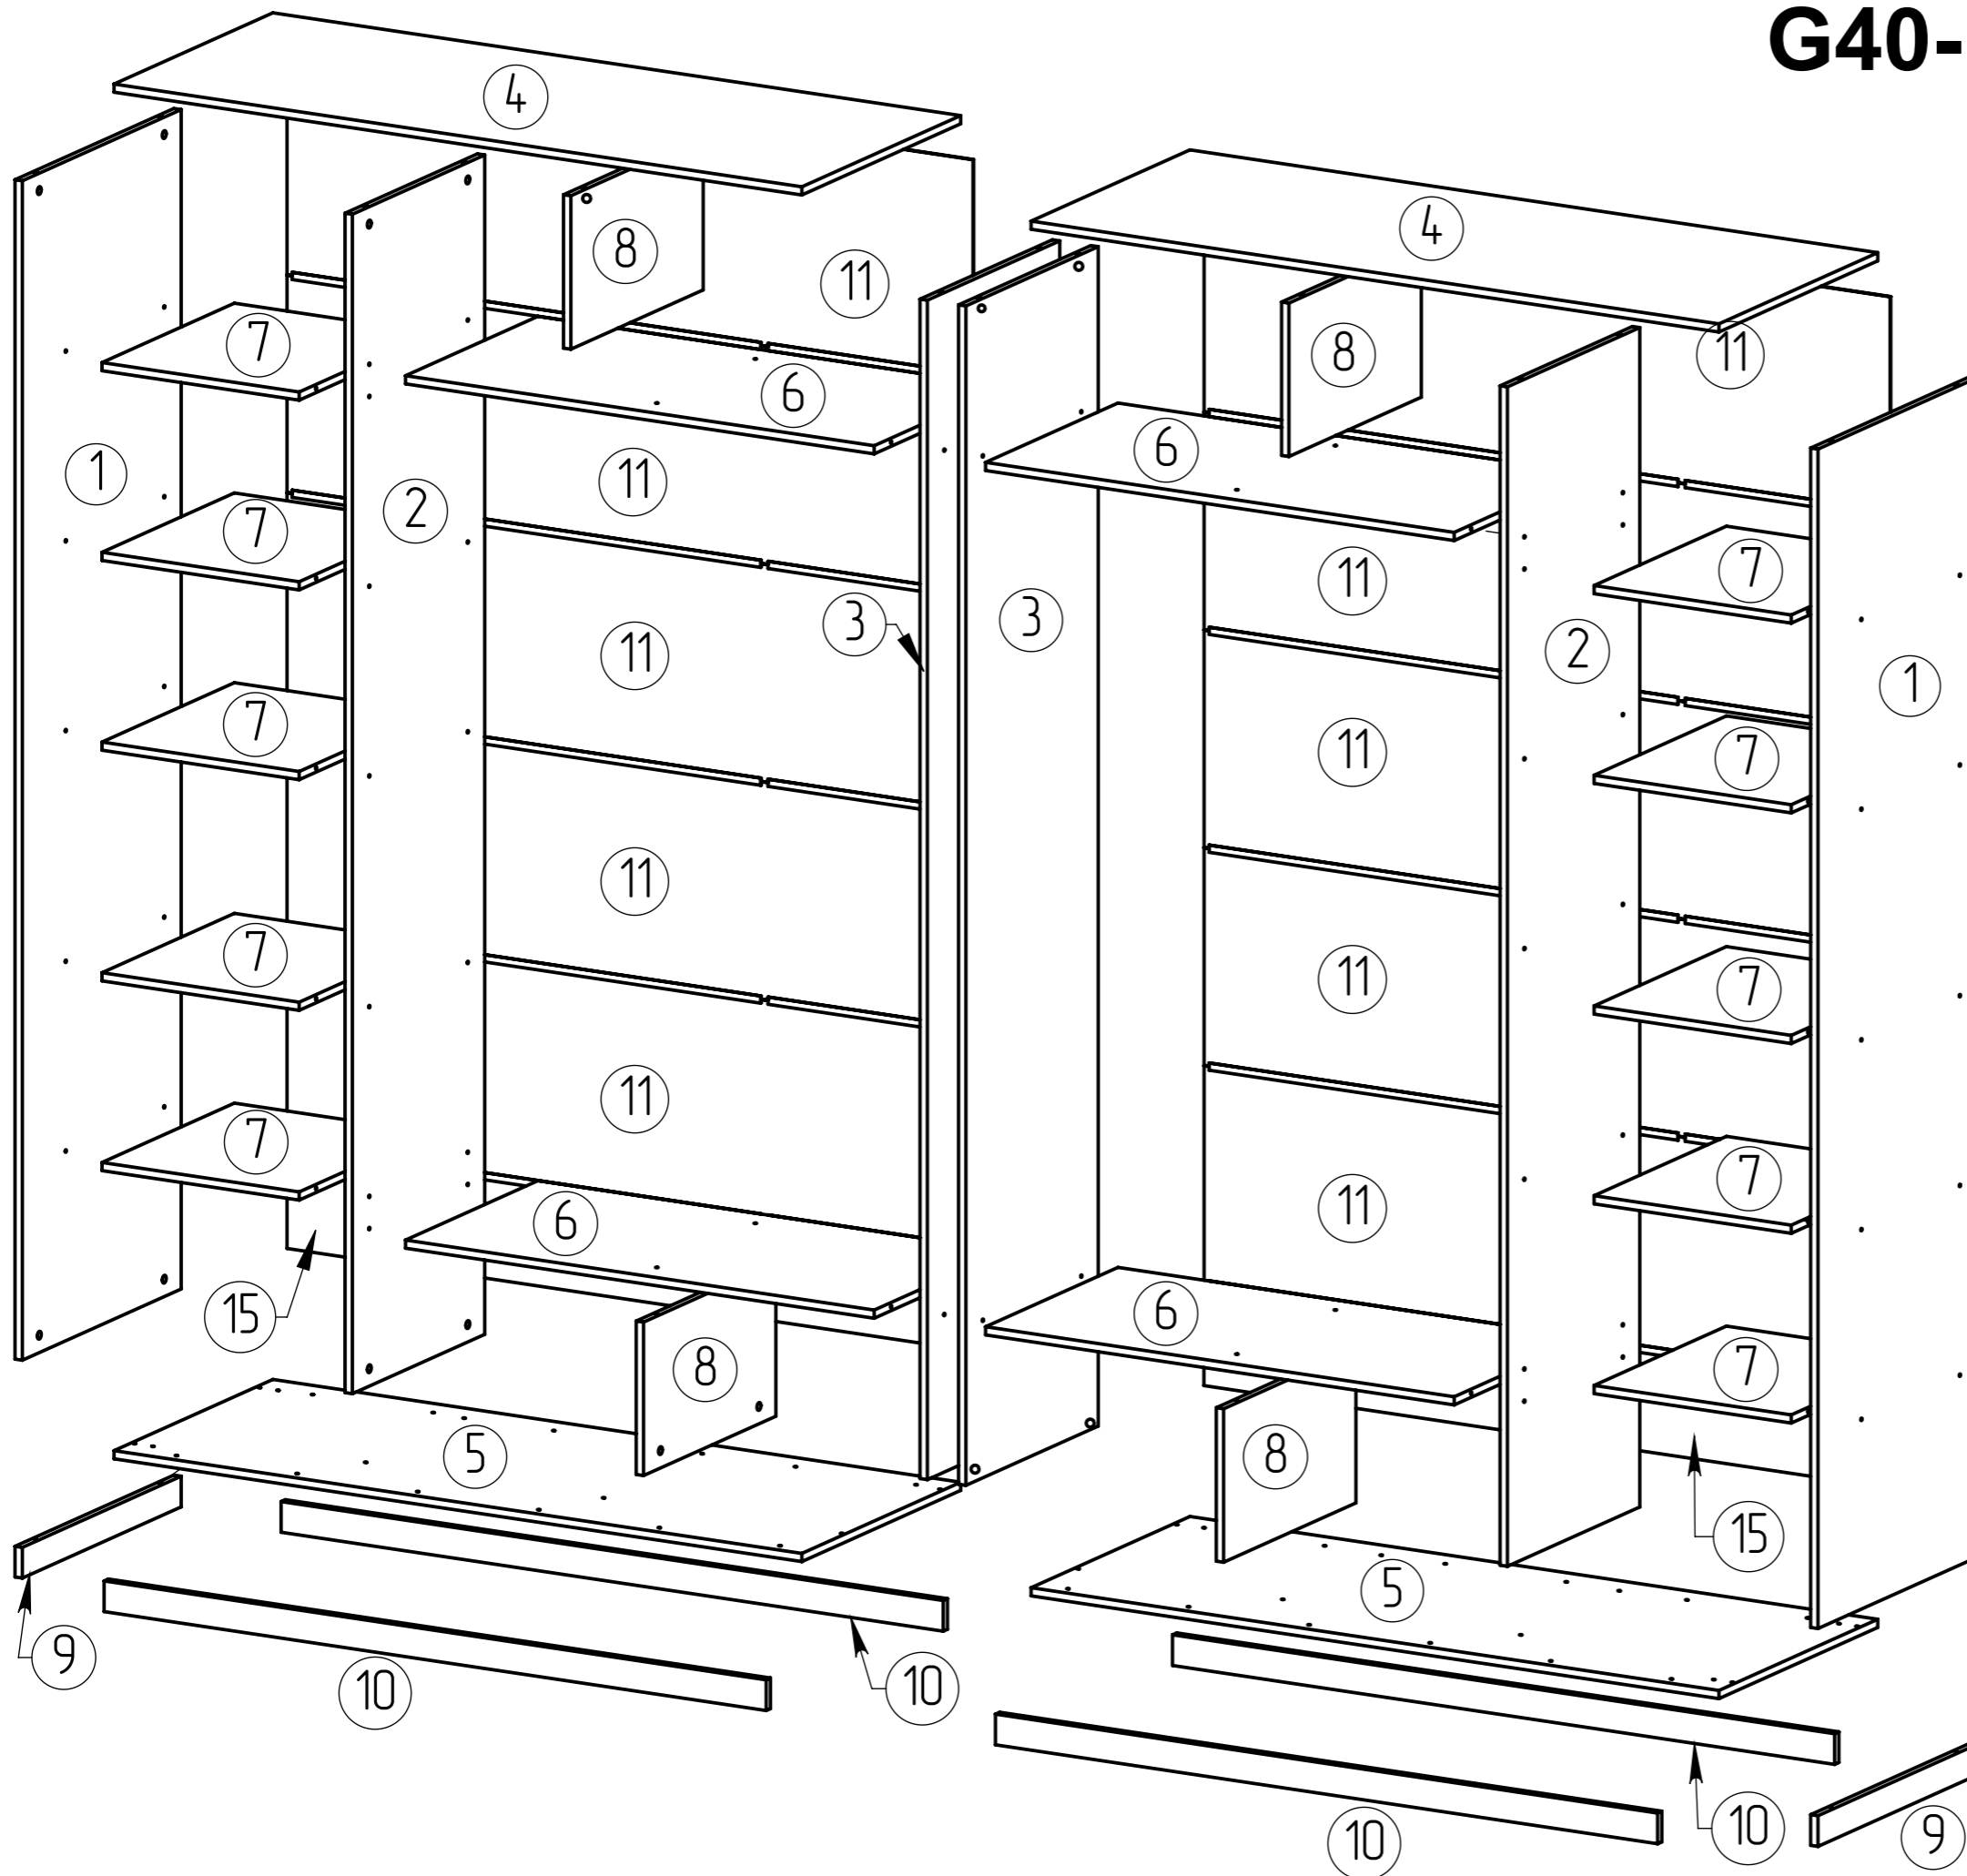

Виробництво меблів: Garant  
м. Новоград-Волинський, Житомирська обл.,  
Україна  
garant-nv.com

Furniture production: Garant  
Novograd-Volynskiy, Zhytomyr Region,  
Ukraine  
garant-nv.com

# ШК 240x45/SDW 240x45

**240/45/280    240/45/290    240/45/300    240/45/310    240/45/320    240/45/330    240/45/340    240/45/350    240/45/360    X**

①	2306x450x16	2306x450x16	2306x450x16	2306x450x16	2306x450x16	2306x450x16	2306x450x16	2306x450x16	2306x450x16	2306x450x16	2
②	2306x350x16	2306x350x16	2306x350x16	2306x350x16	2306x350x16	2306x350x16	2306x350x16	2306x350x16	2306x350x16	2306x350x16	2
③	2306x350x16	2306x350x16	2306x350x16	2306x350x16	2306x350x16	2306x350x16	2306x350x16	2106x350x16	2306x350x16	2306x350x16	2
④	1400x450x16	1450x450x16	1500x450x16	1550x450x16	1600x450x16	1650x450x16	1700x450x16	1750x450x16	1800x450x16	1800x450x16	4
⑤	1400x450x16	1450x450x16	1500x450x16	1550x450x16	1600x450x16	1650x450x16	1700x450x16	1750x450x16	1800x450x16	1800x450x16	4
⑥	922x350x16	972x350x16	1022x350x16	1072x350x16	1122x350x16	1172x350x16	1052x350x16	1102x350x16	1152x350x16	1152x350x16	4
⑦	430x350x16	430x350x16	430x350x16	430x350x16	430x350x16	430x350x16	600x350x16	600x350x16	600x350x16	600x350x16	10
⑧	300x350x16	300x350x16	300x350x16	300x350x16	300x350x16	300x350x16	300x350x16	300x350x16	300x350x16	300x350x16	4
⑨	450x60x16	450x60x16	450x60x16	450x60x16	450x60x16	450x60x16	450x60x16	450x60x16	450x60x16	450x60x16	2
⑩	1344x60x16	1394x60x16	1444x60x16	1494x60x16	1544x60x16	1594x60x16	1644x60x16	1694x60x16	1744x60x16	1744x60x16	4
⑪	425x1396x2,5	425x1446x2,5	425x1496x2,5	425x1546x2,5	425x1596x2,5	425x1646x2,5	425x1696x2,5	425x1746x2,5	425x1796x2,5	425x1796x2,5	10
⑫	2264x705	2264x730	2264x755	2264x780	2264x805	2264x830	2264x855	2264x880	2264x905	2264x905	4
⑬	L=2764	L=2864	L=2964	L=3064	L=3164	L=3264	L=3364	L=3464	L=3564	L=3564	1
⑭	L=2764	L=2864	L=2964	L=3064	L=3164	L=3264	L=3364	L=3464	L=3564	L=3564	1
⑮	199x1396x2,5	199x1446x2,5	199x1496x2,5	199x1546x2,5	199x1596x2,5	199x1646x2,5	199x1696x2,5	199x1746x2,5	199x1796x2,5	199x1796x2,5	2

A



x85

A1



x85


B



x56

4,0\*16

C

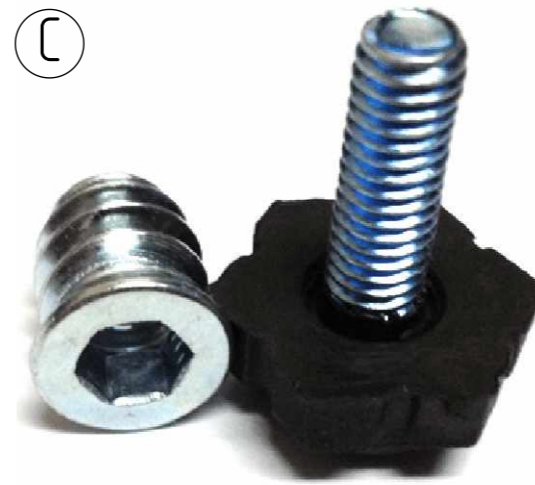

x16

D




x150

E



x32

E1

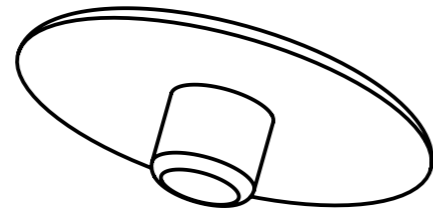

x32

F



x18,12

G



x4

H



x4

I



x16

J



x16



L





x6

1

X2

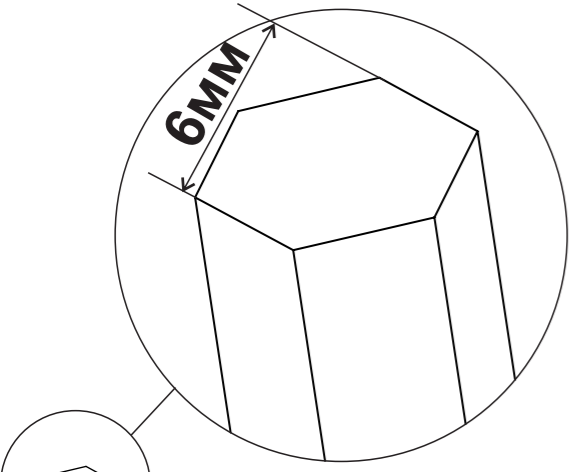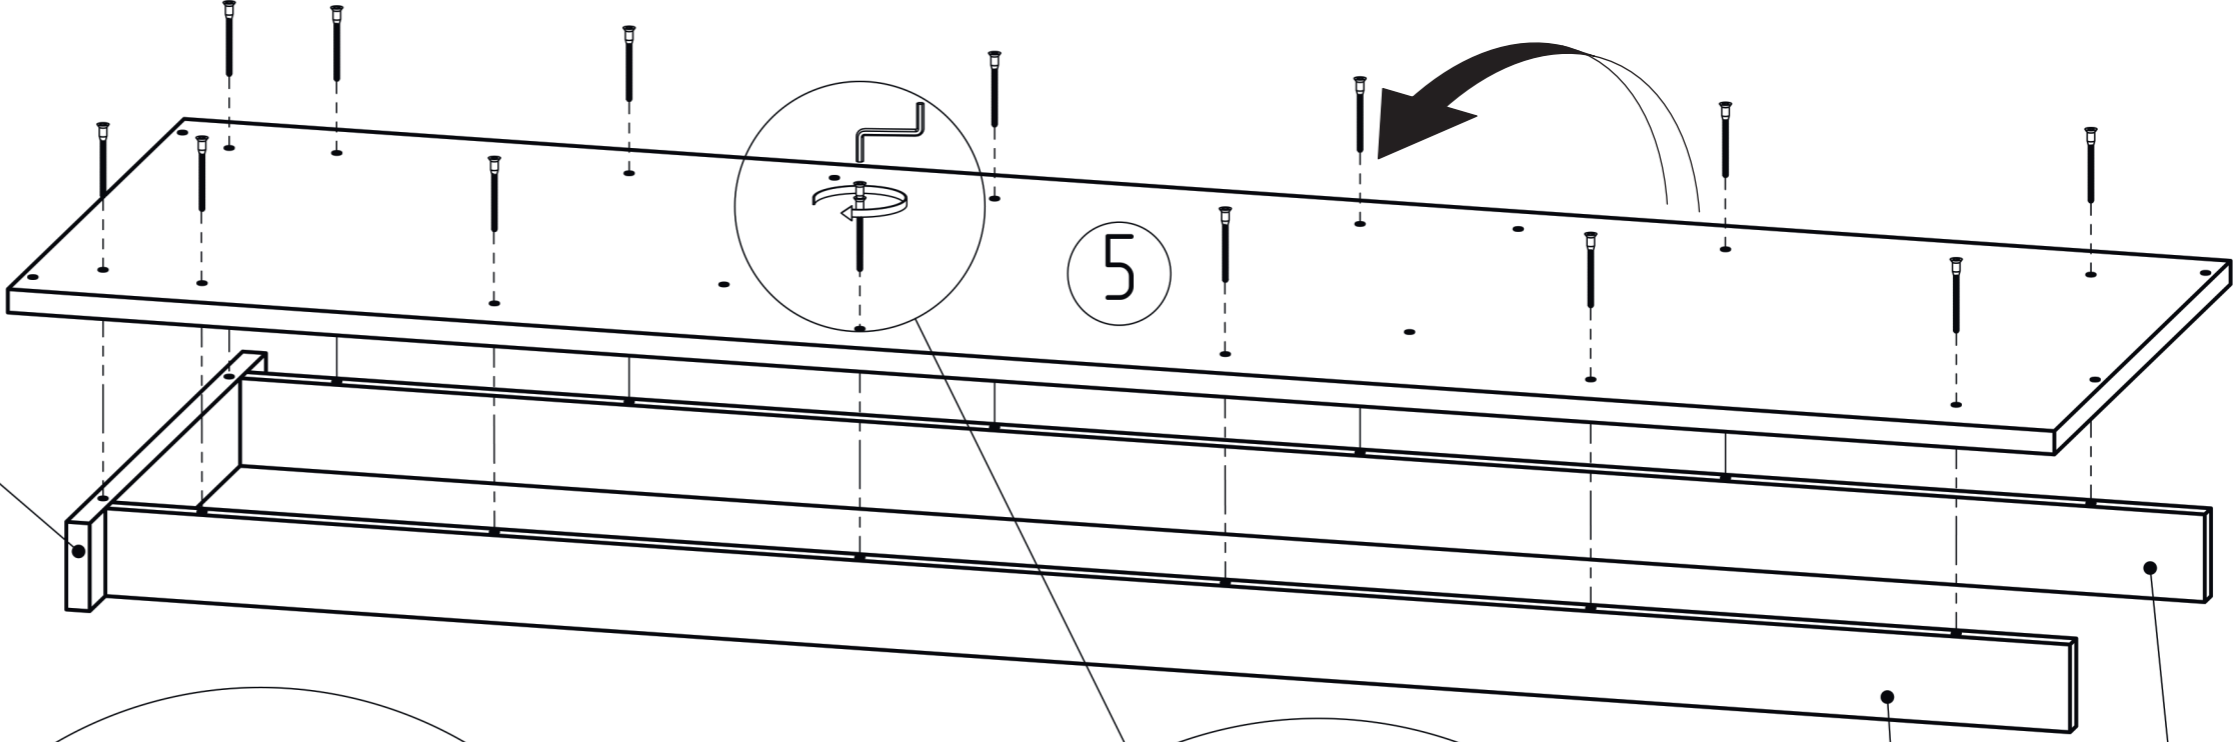


Ø 9 mm

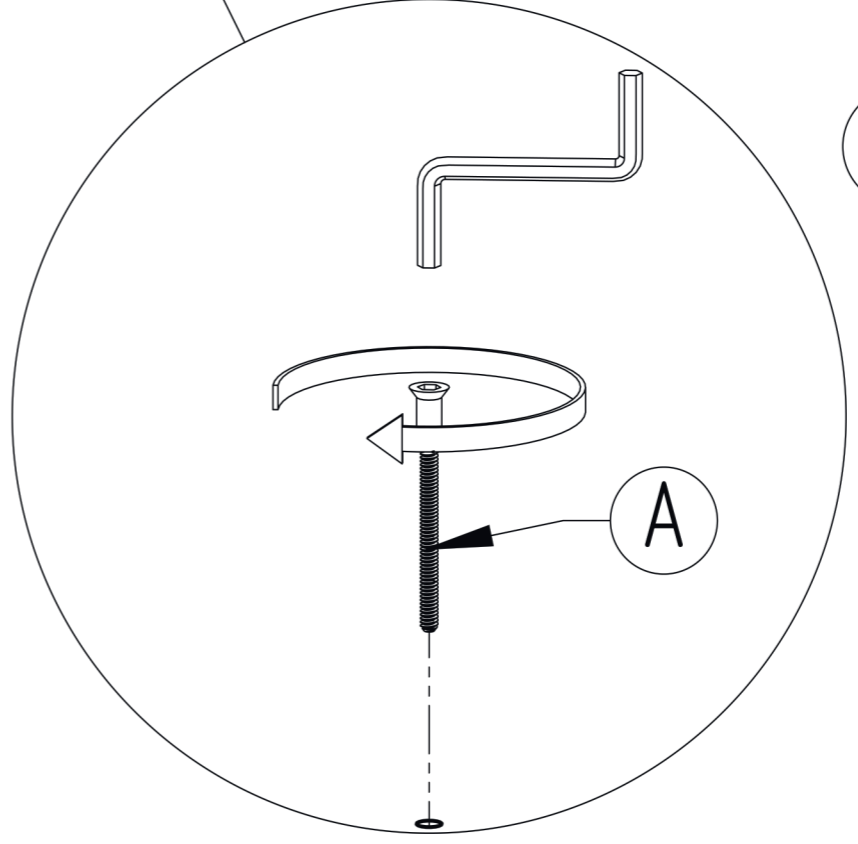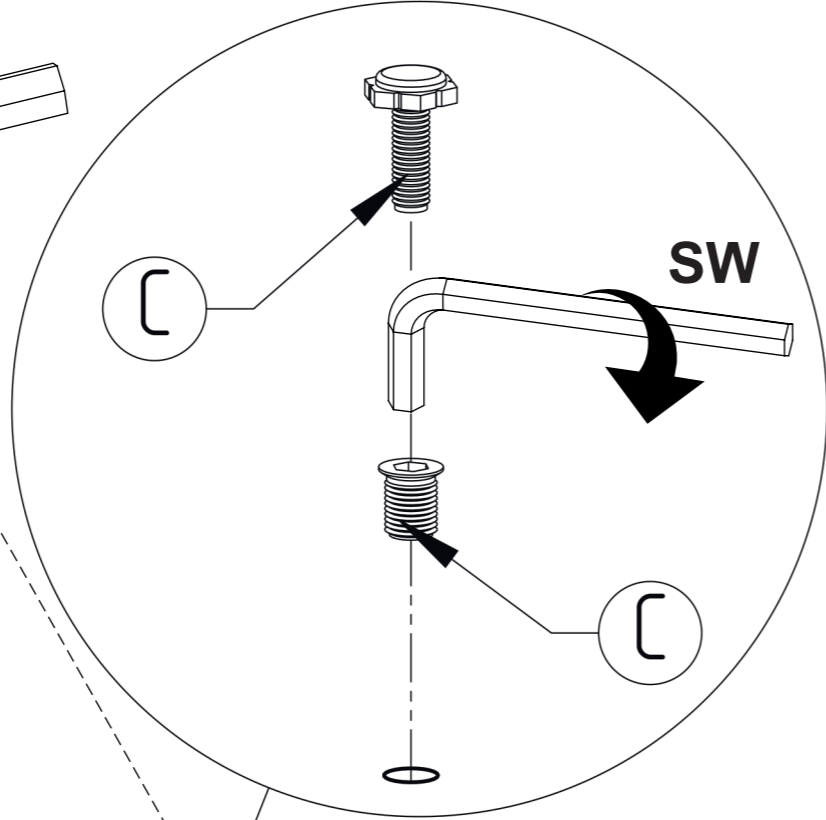

10

10


9

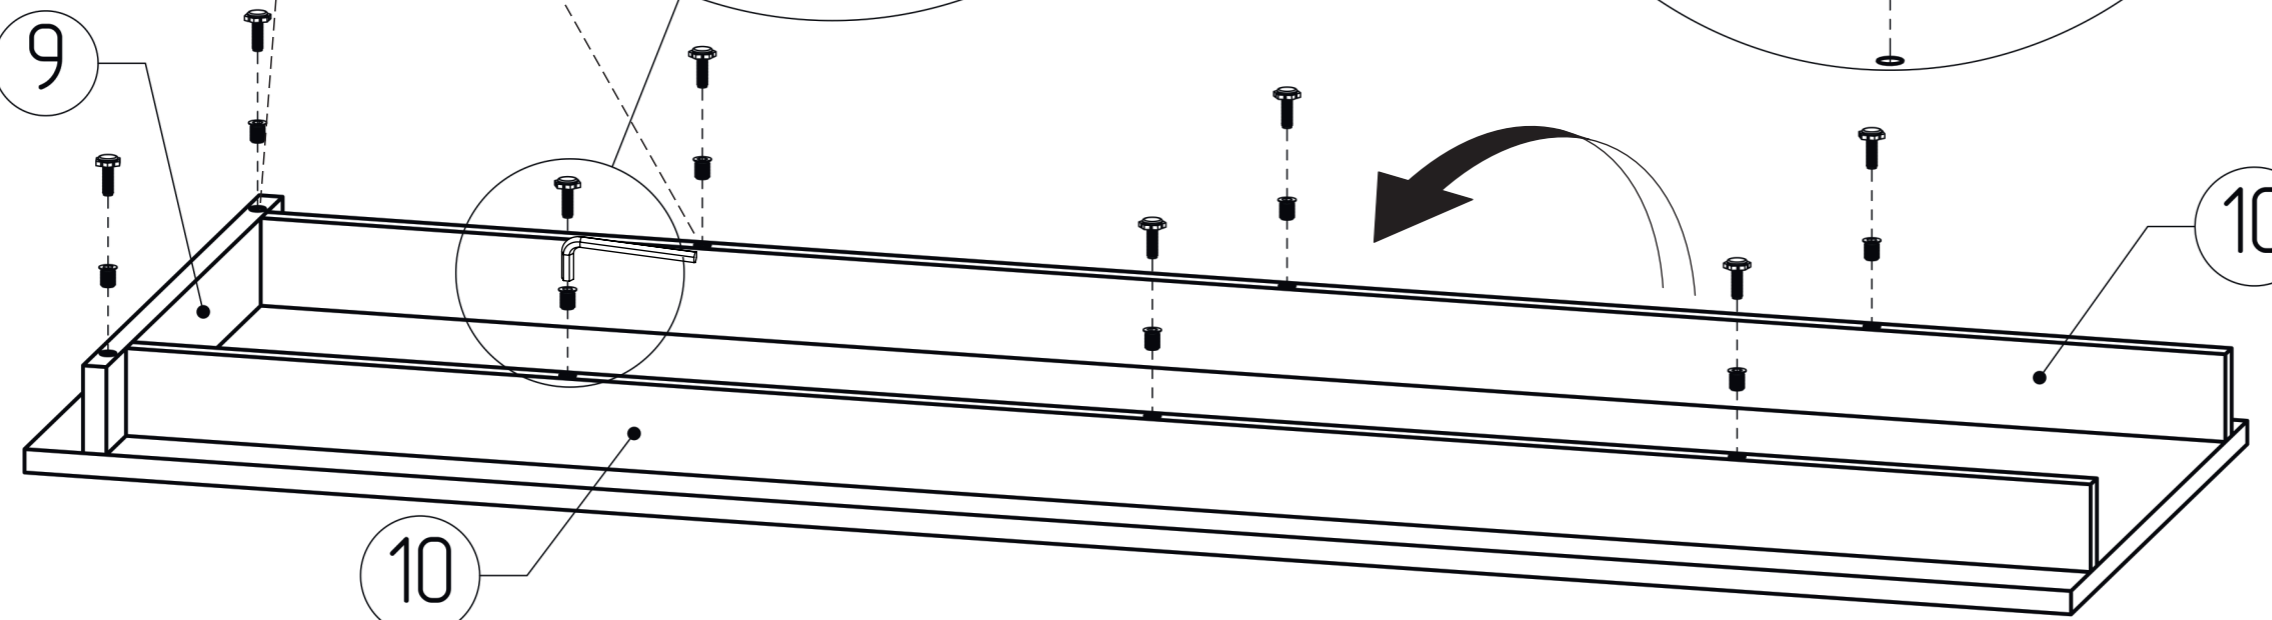



10

X2

2

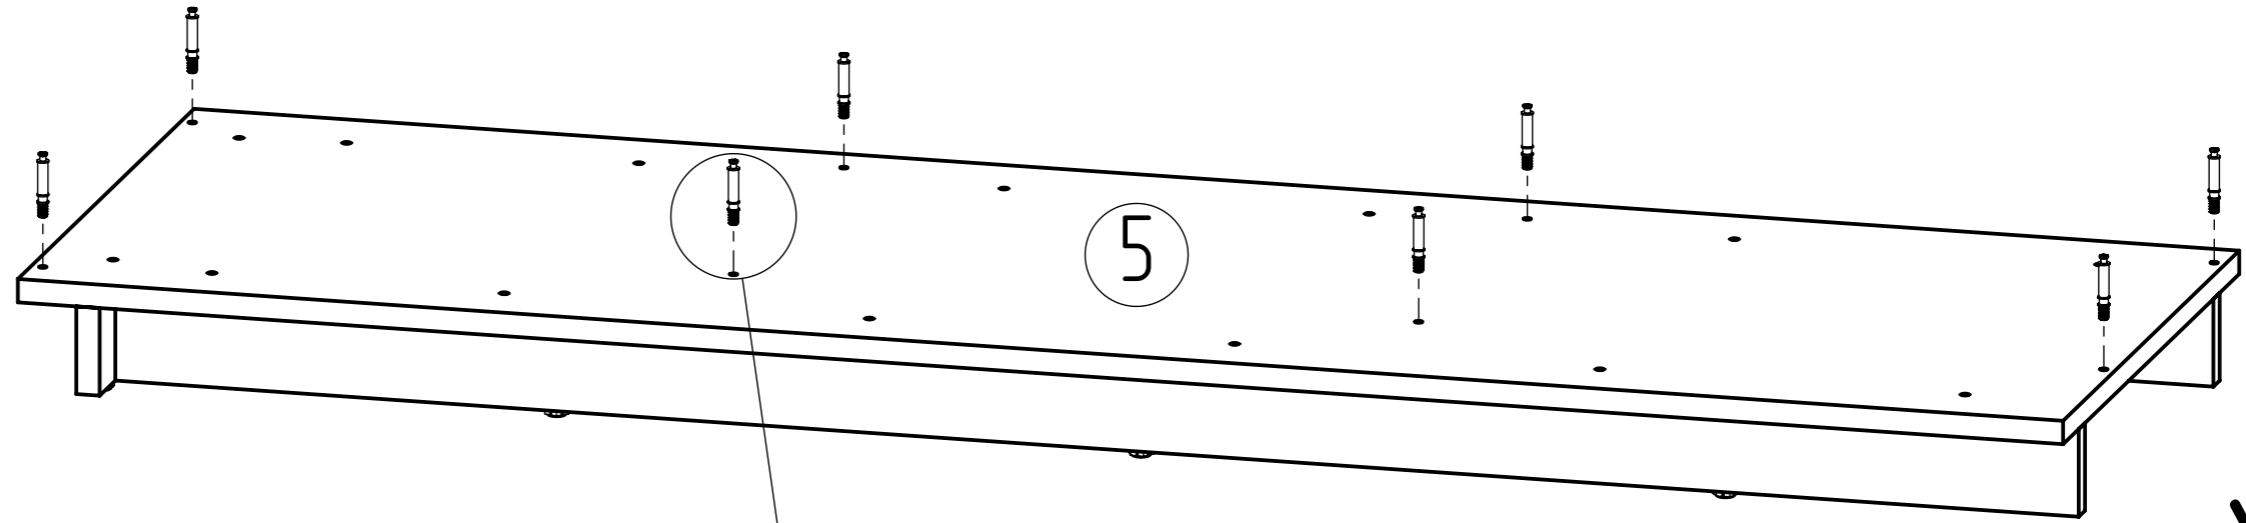


X2


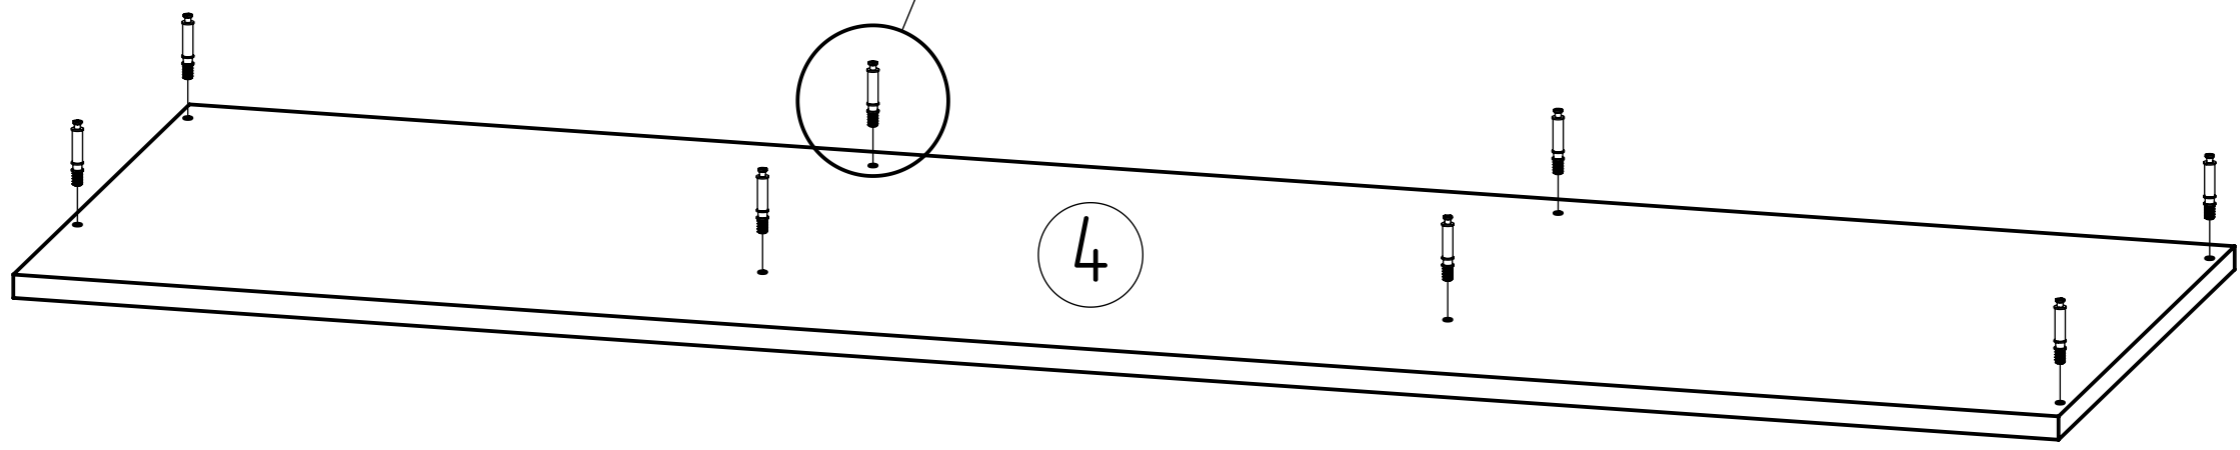
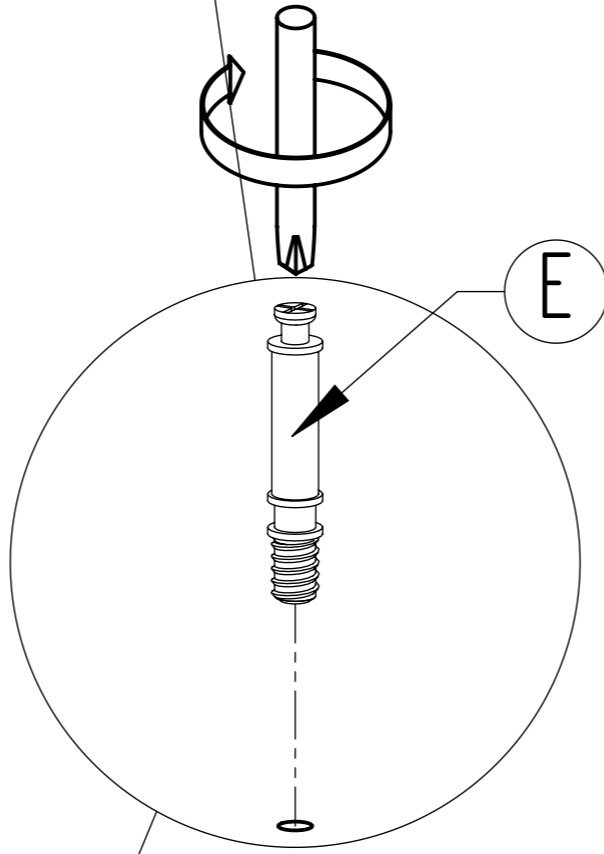


X2




3

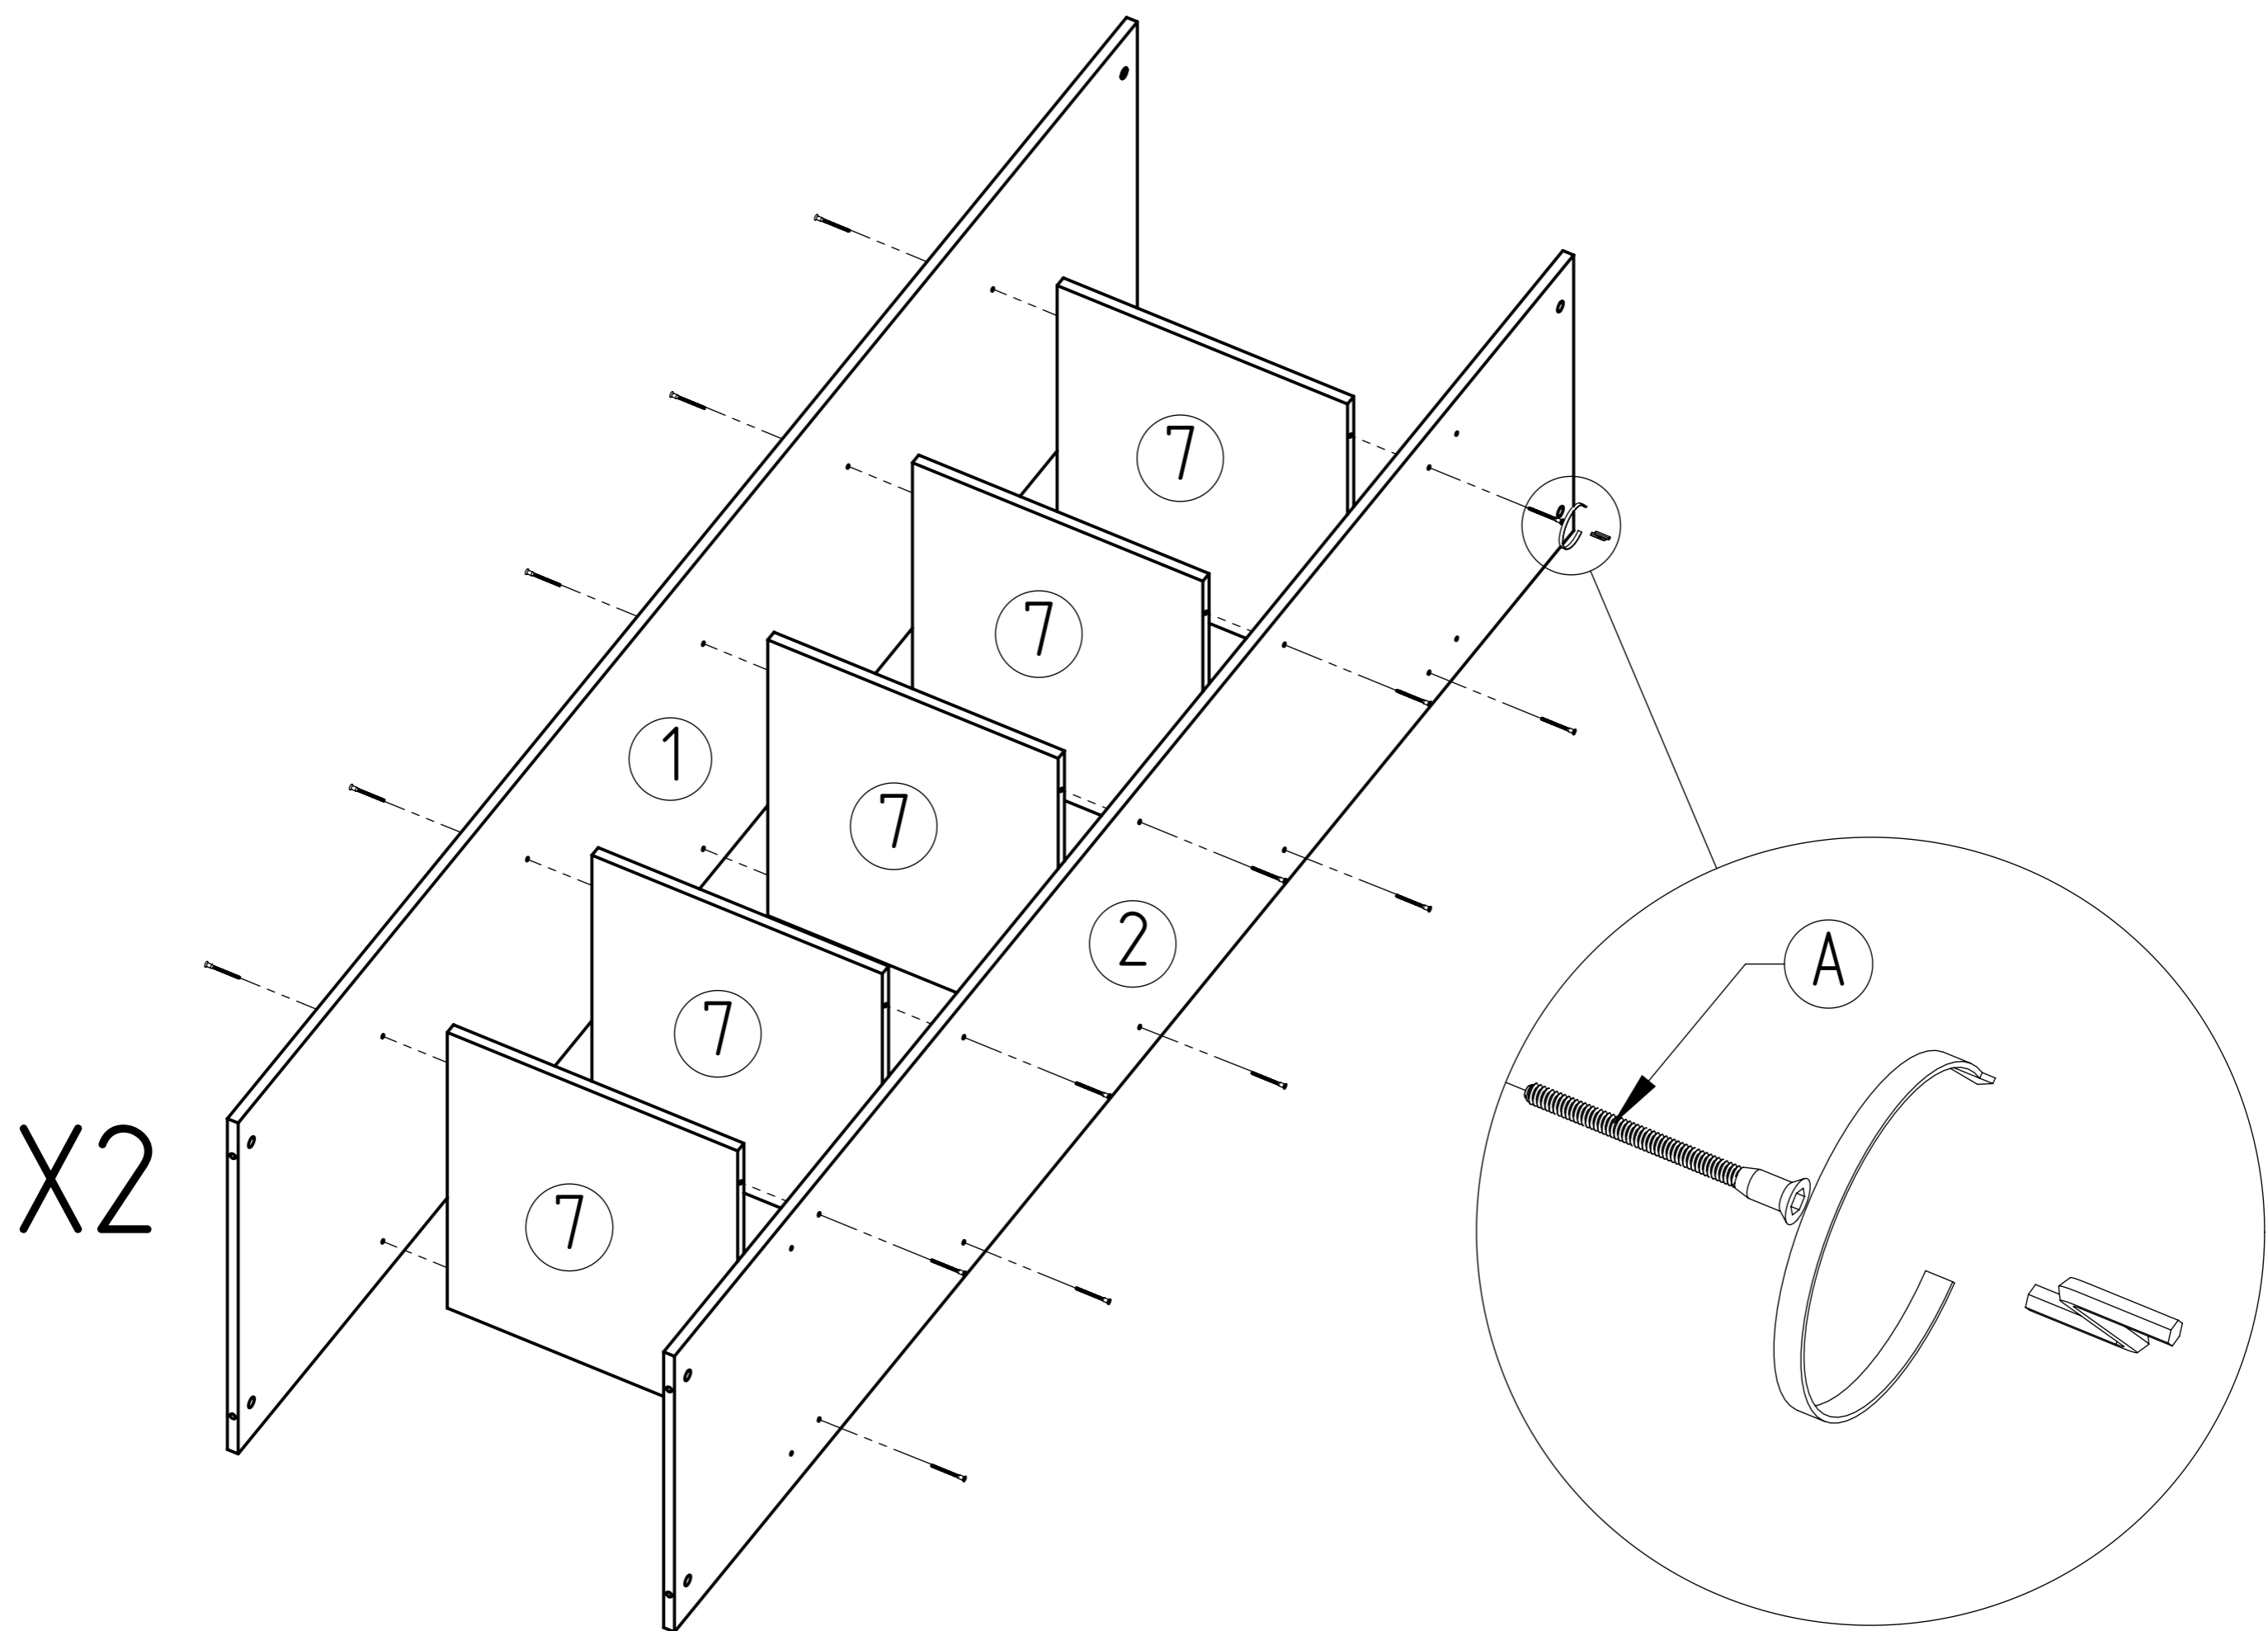

4

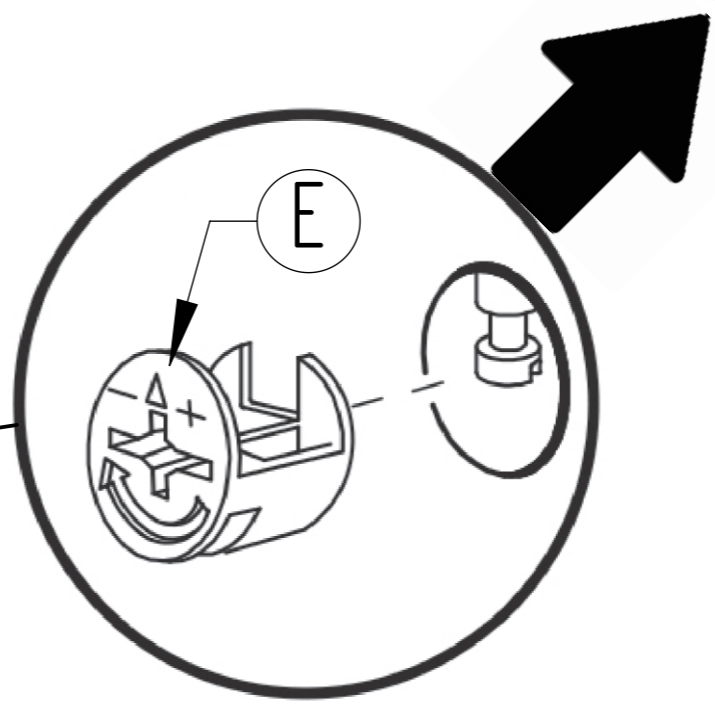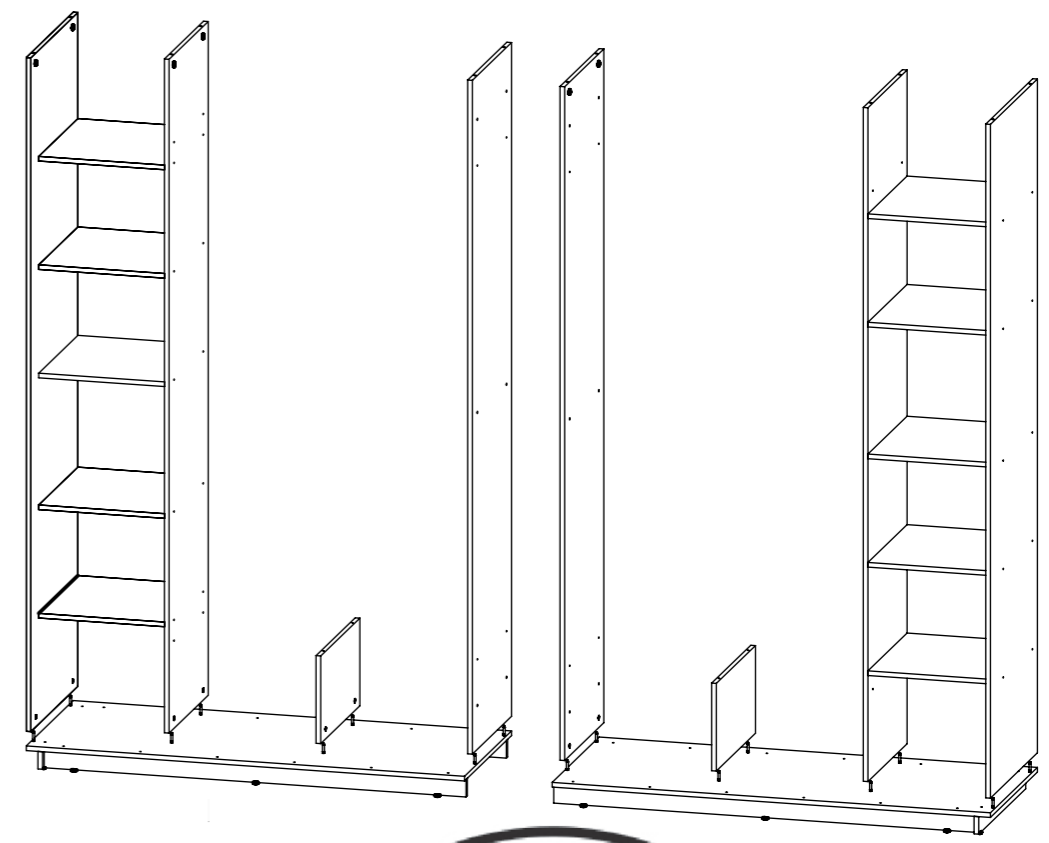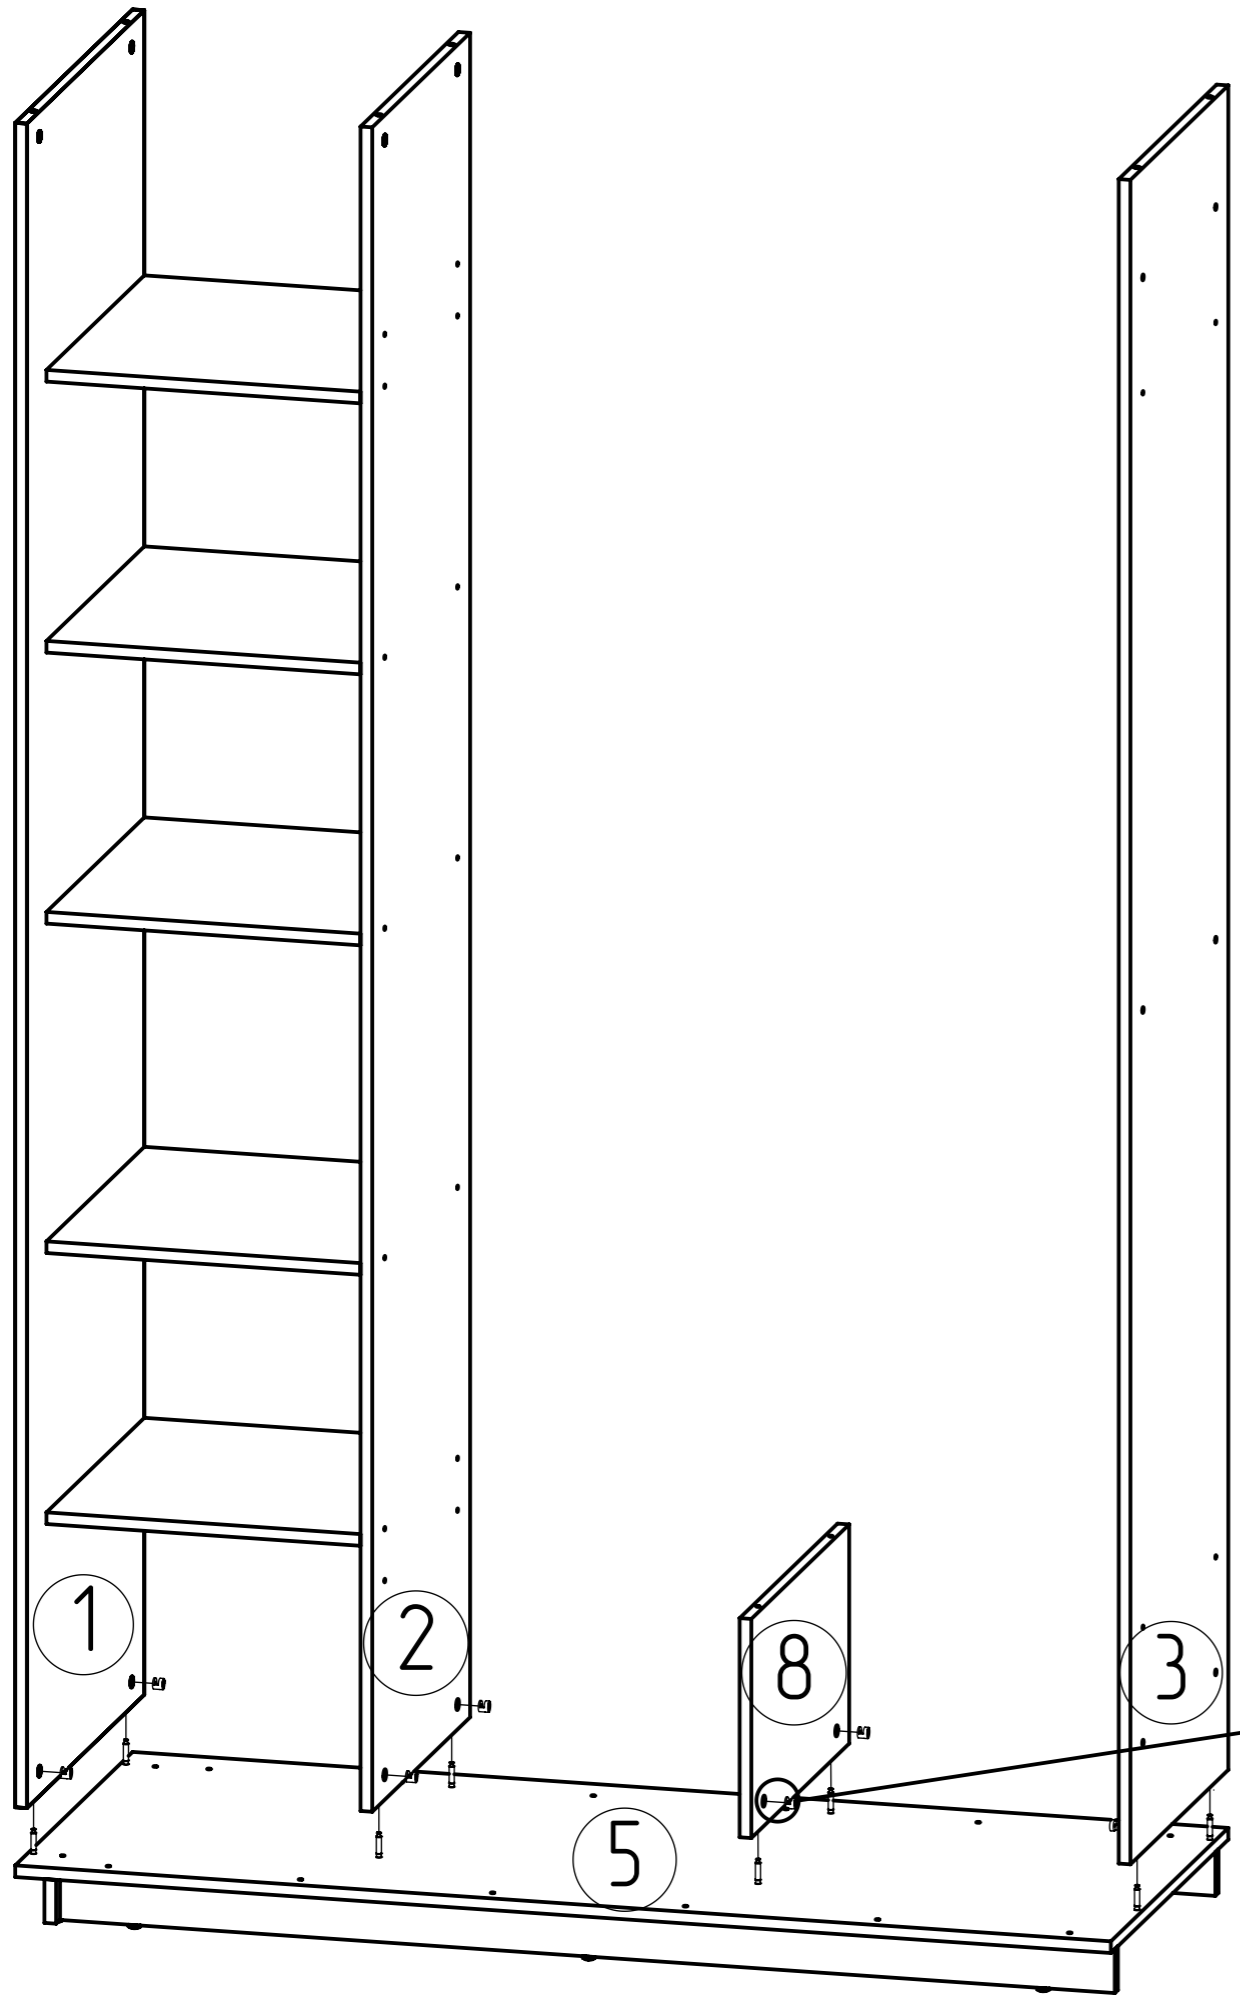





5

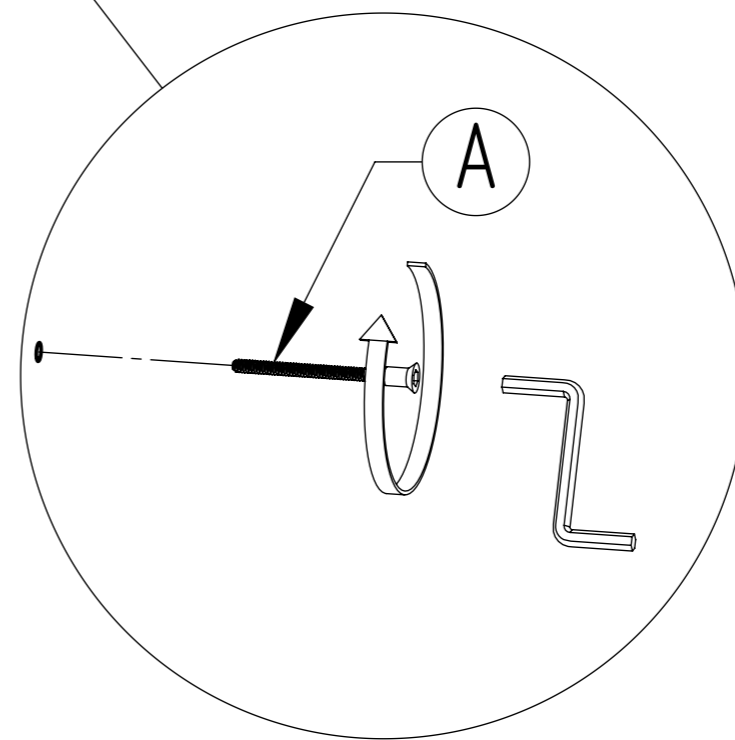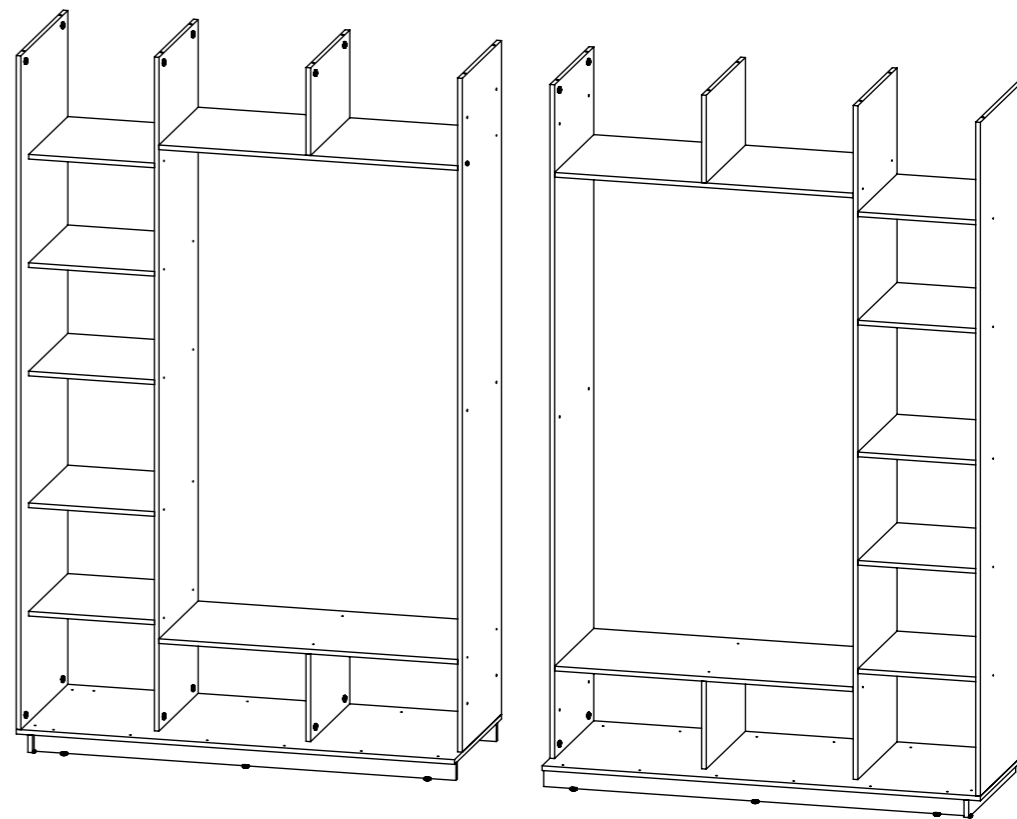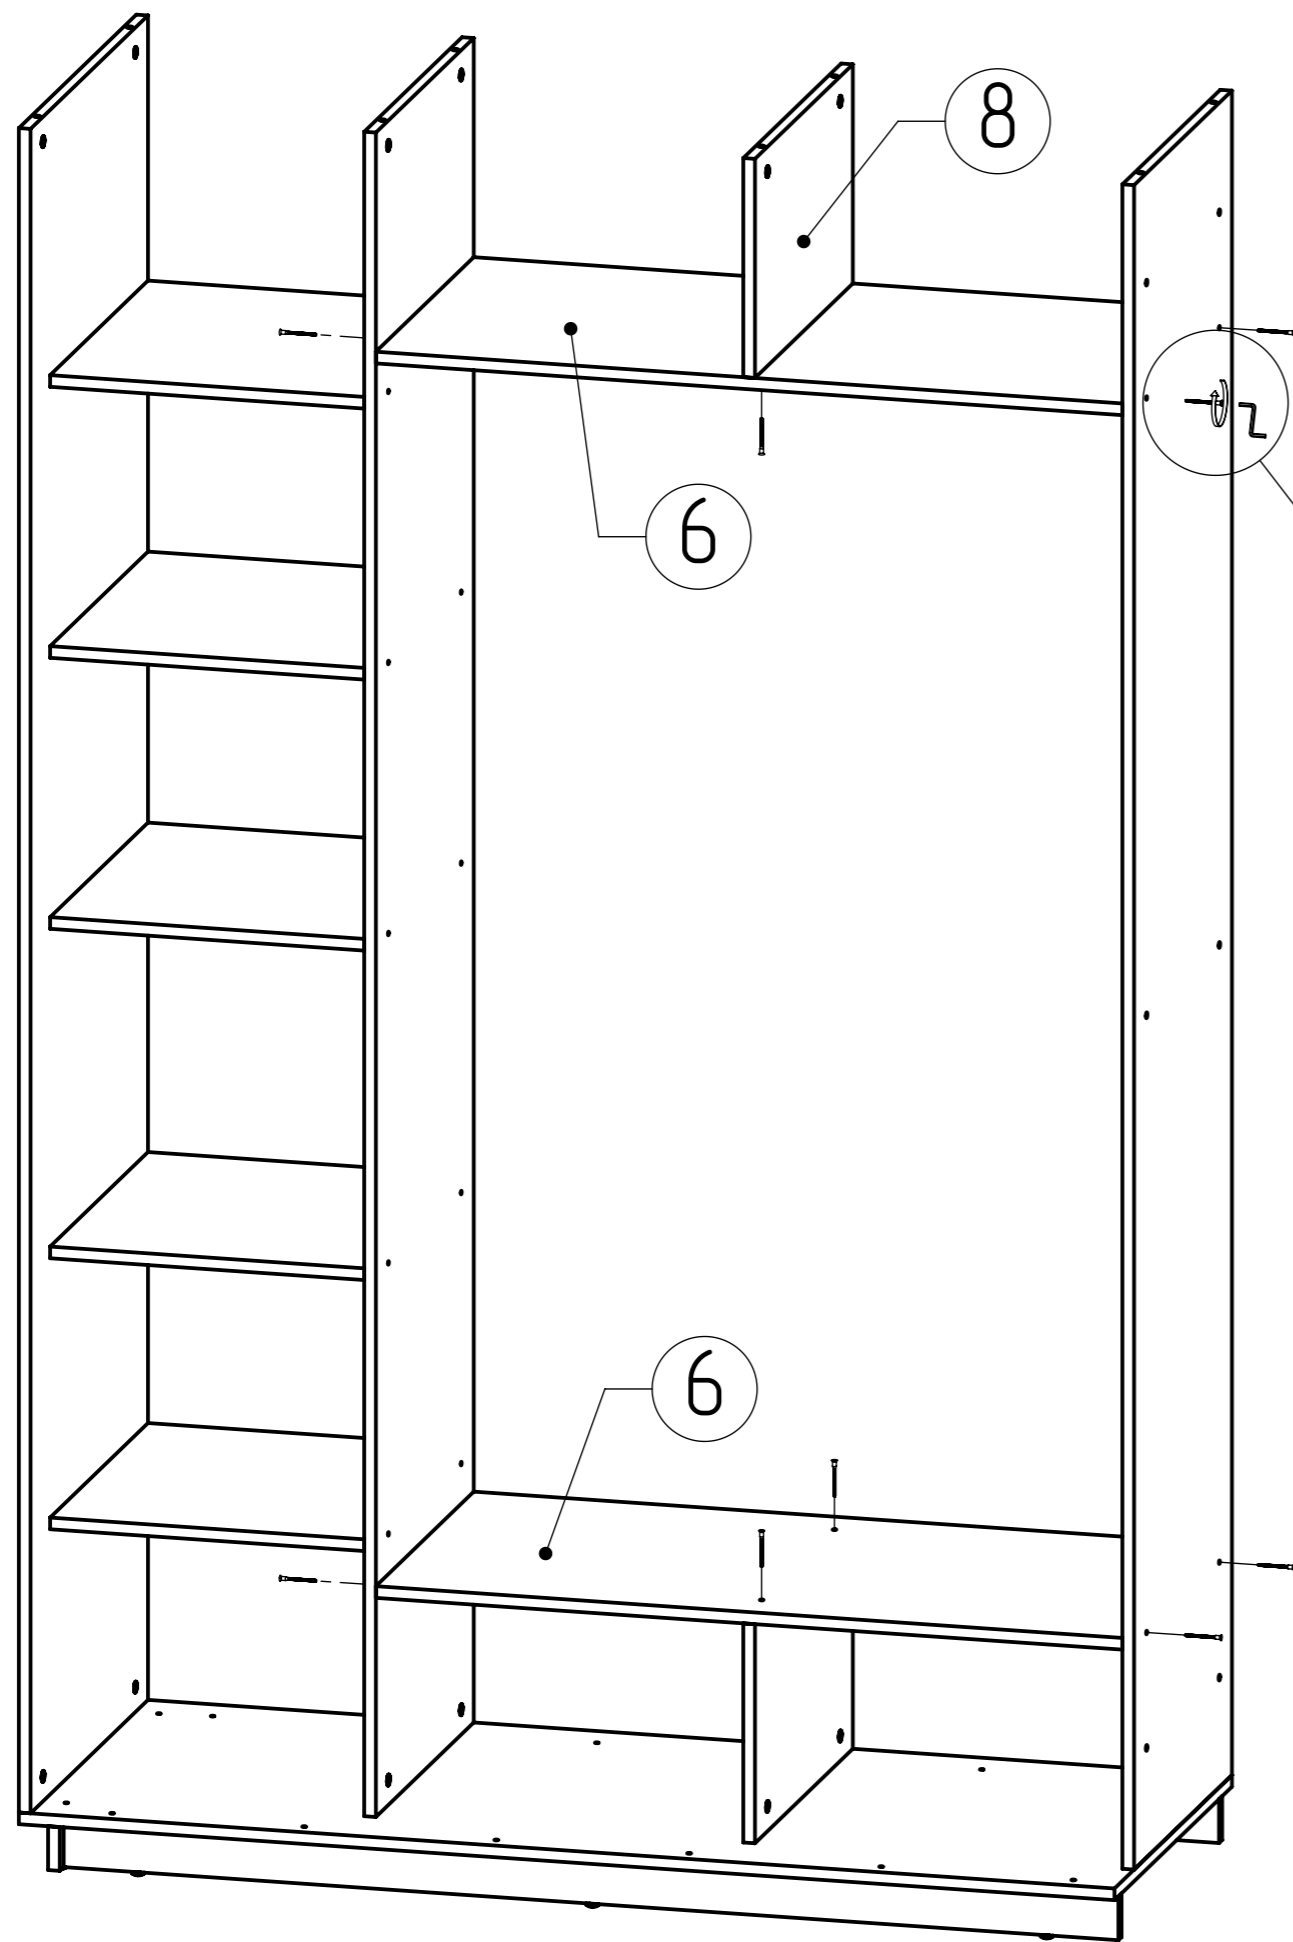

X2







6

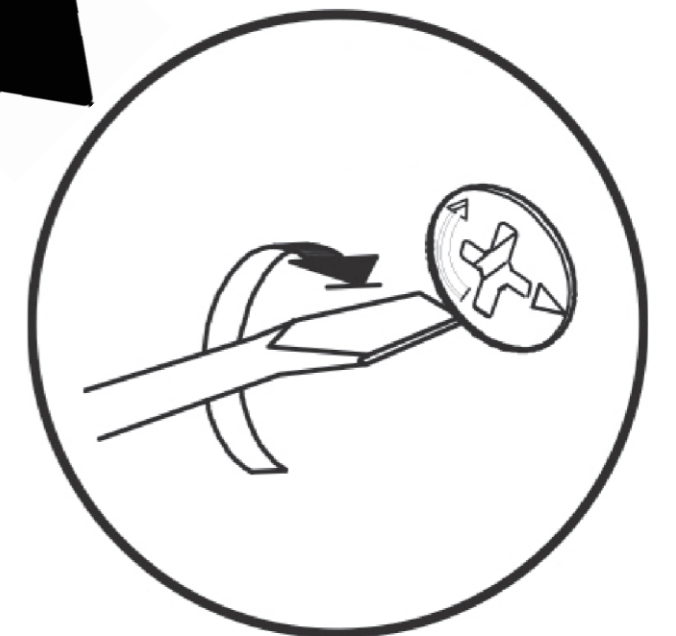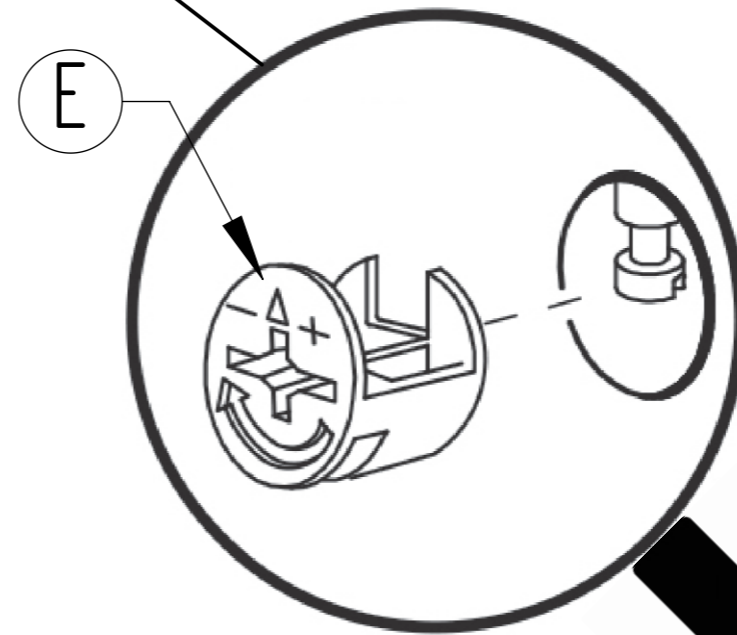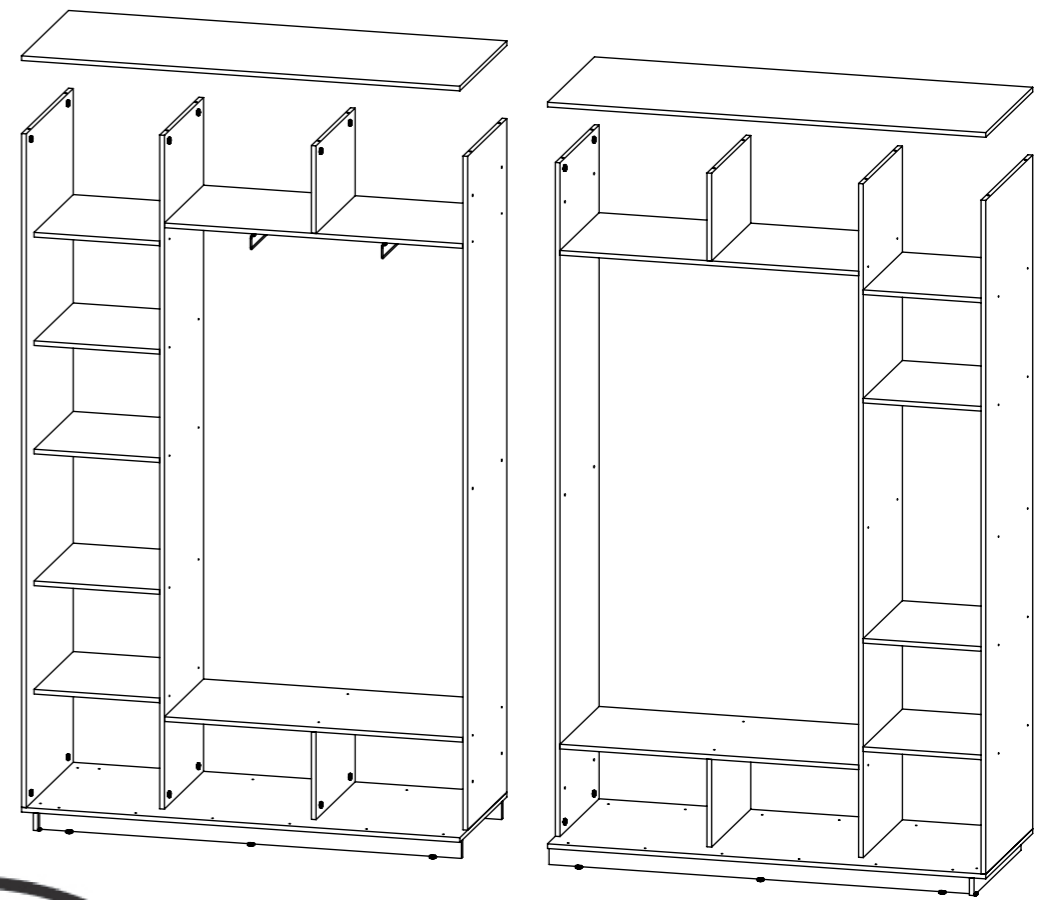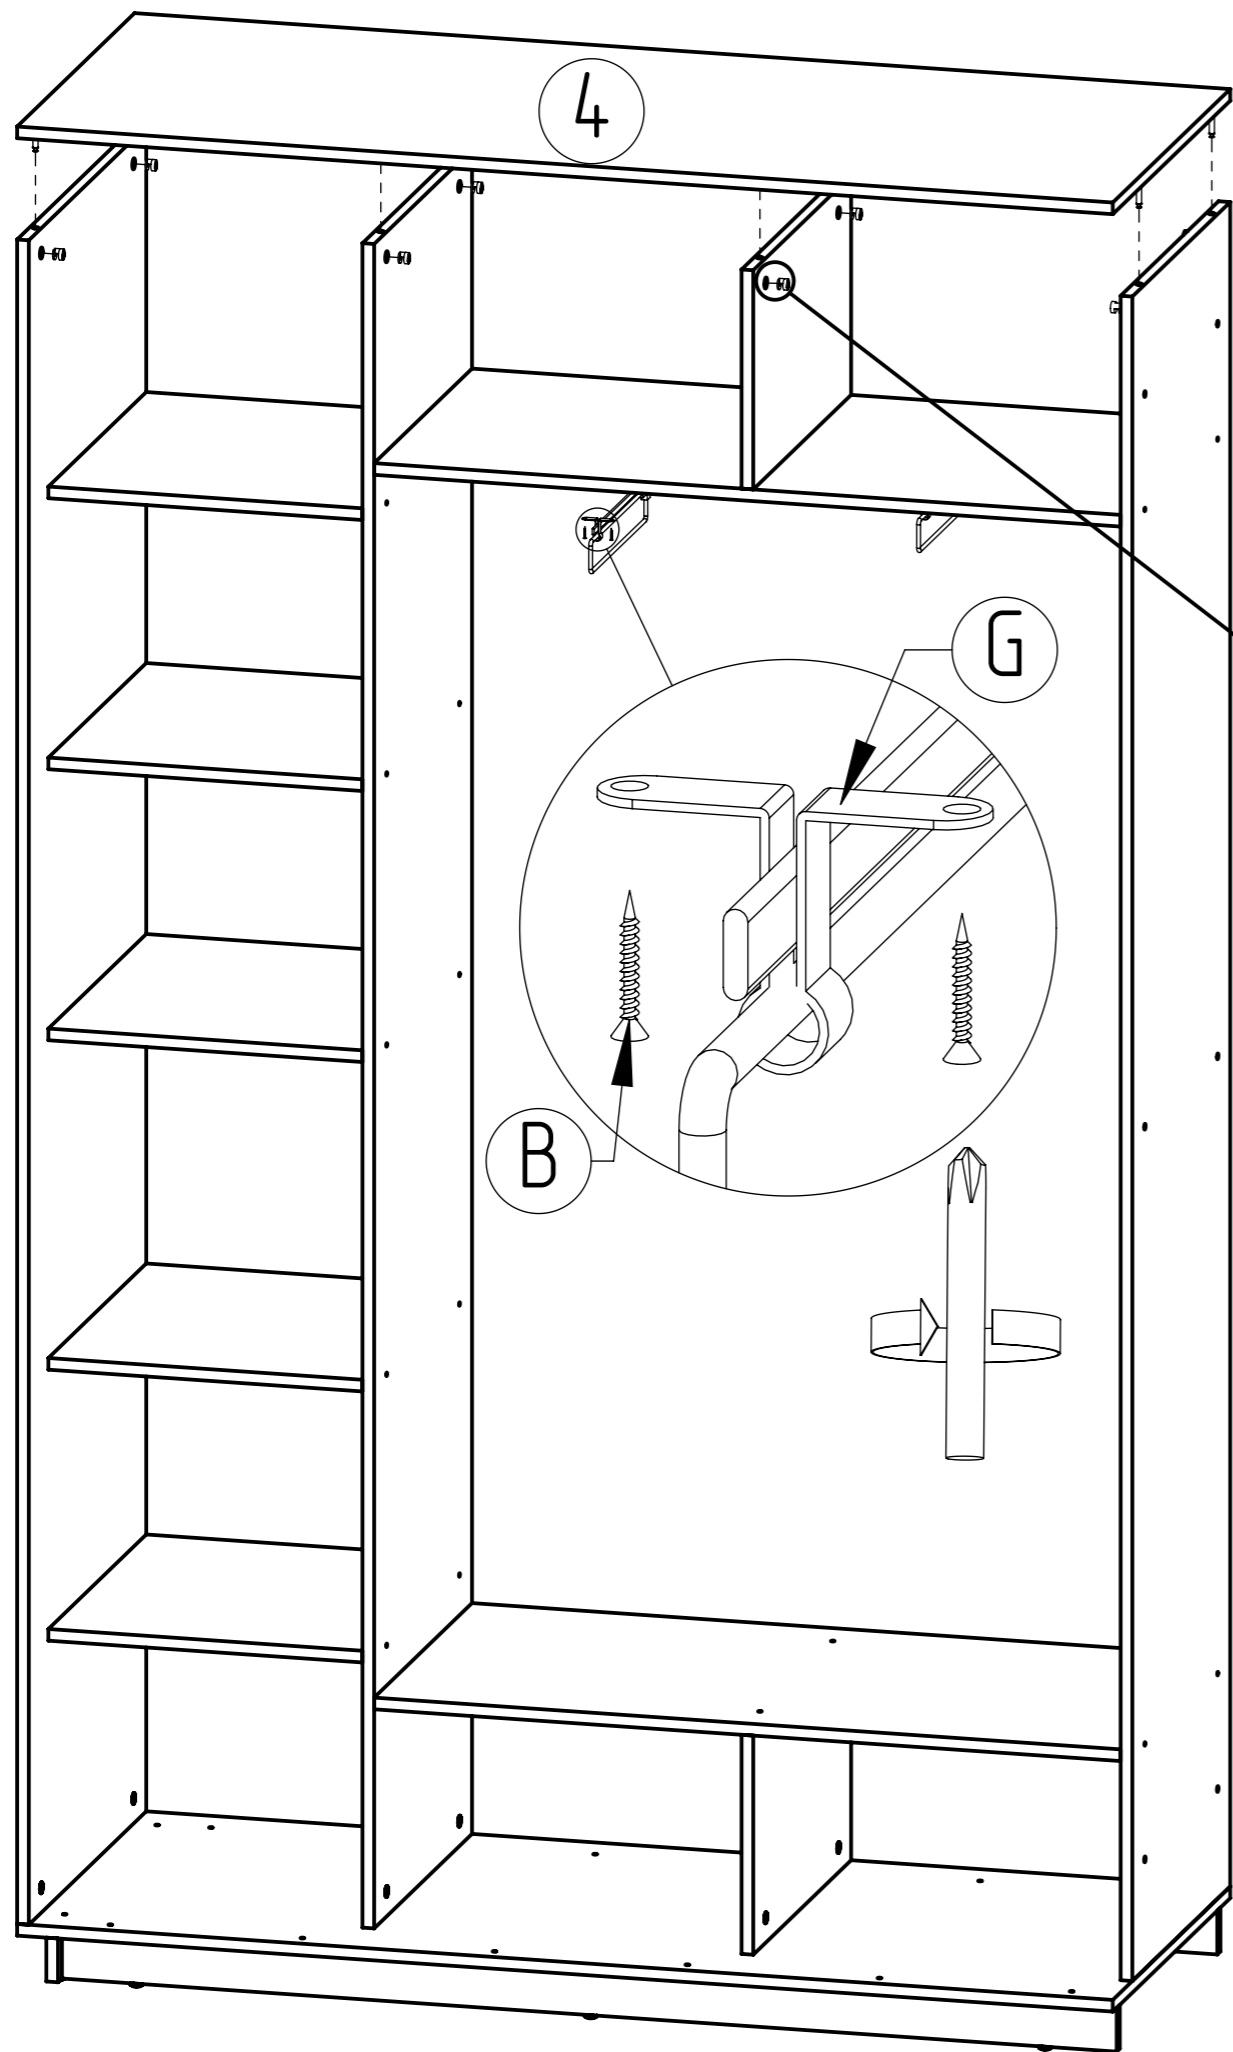

X2







7

a = b

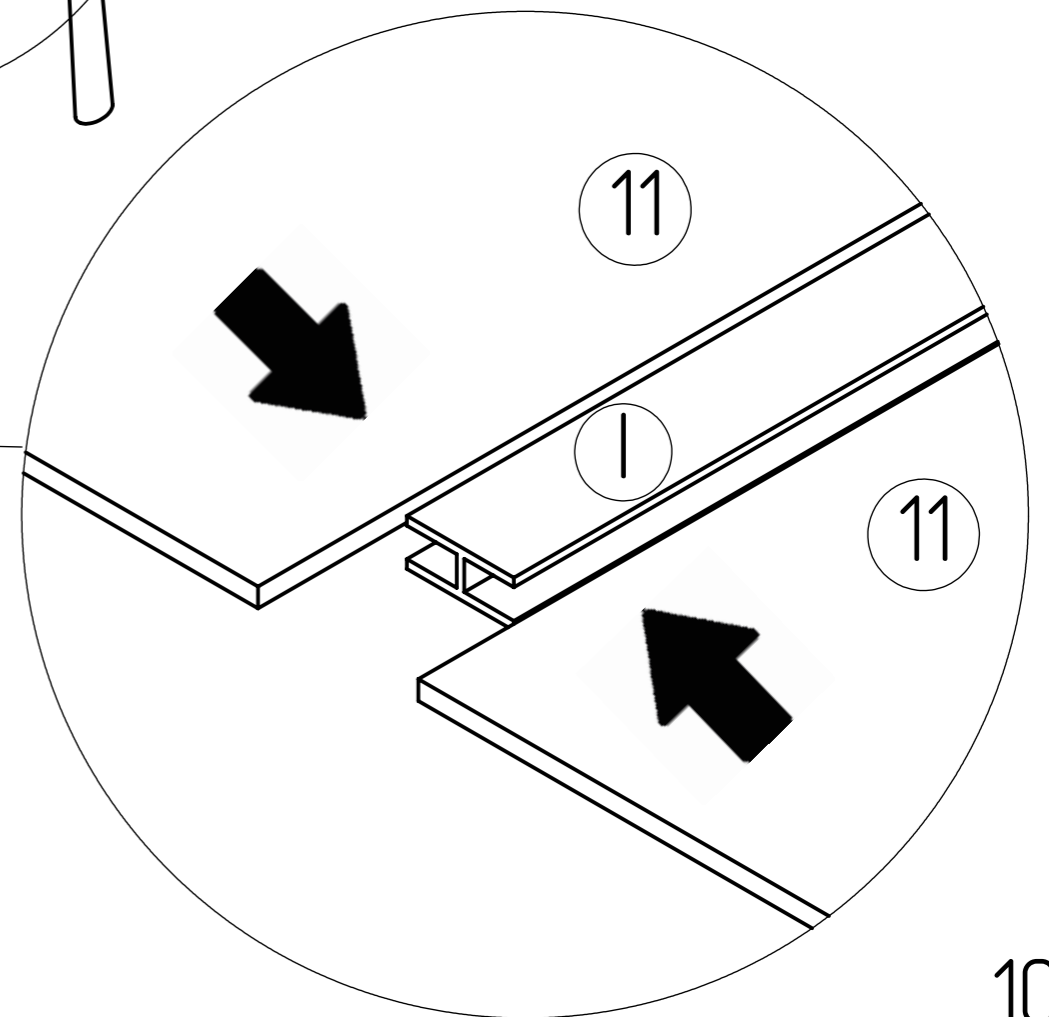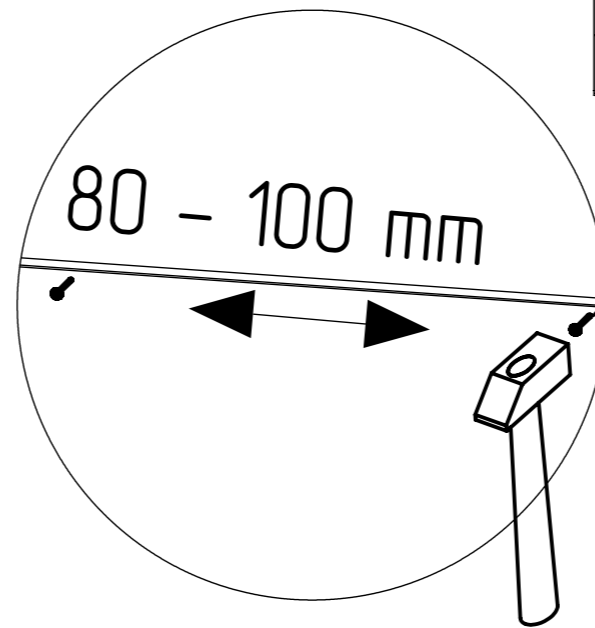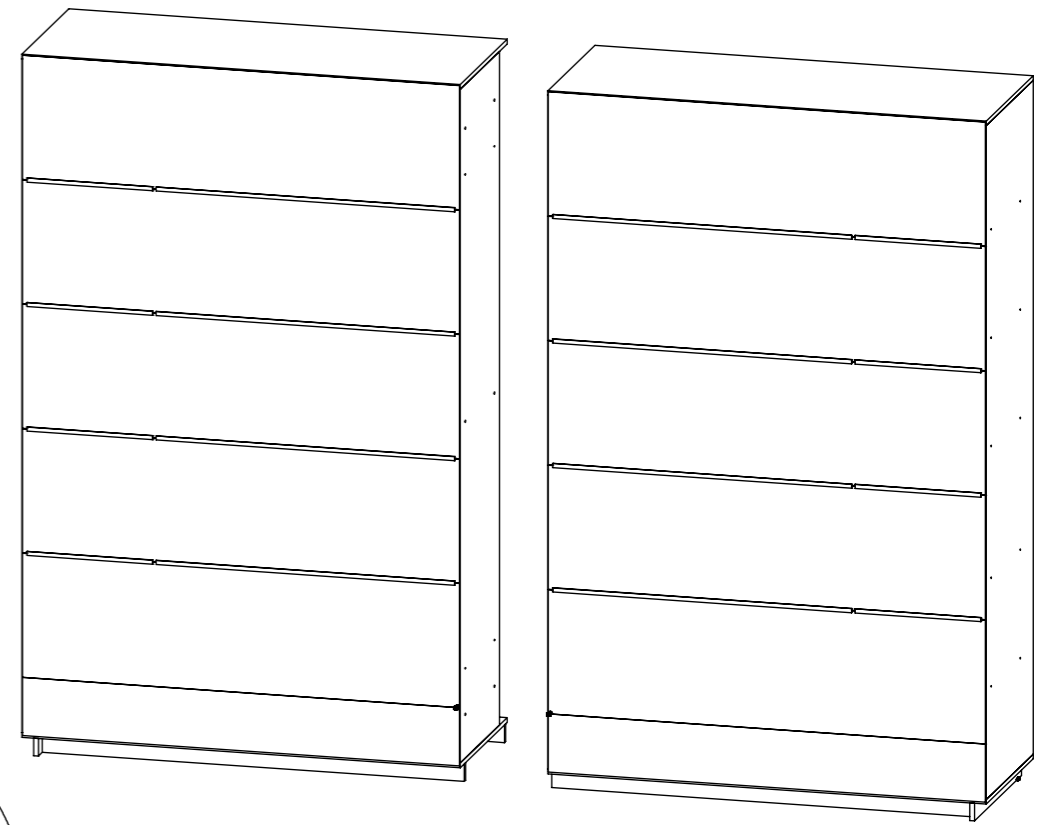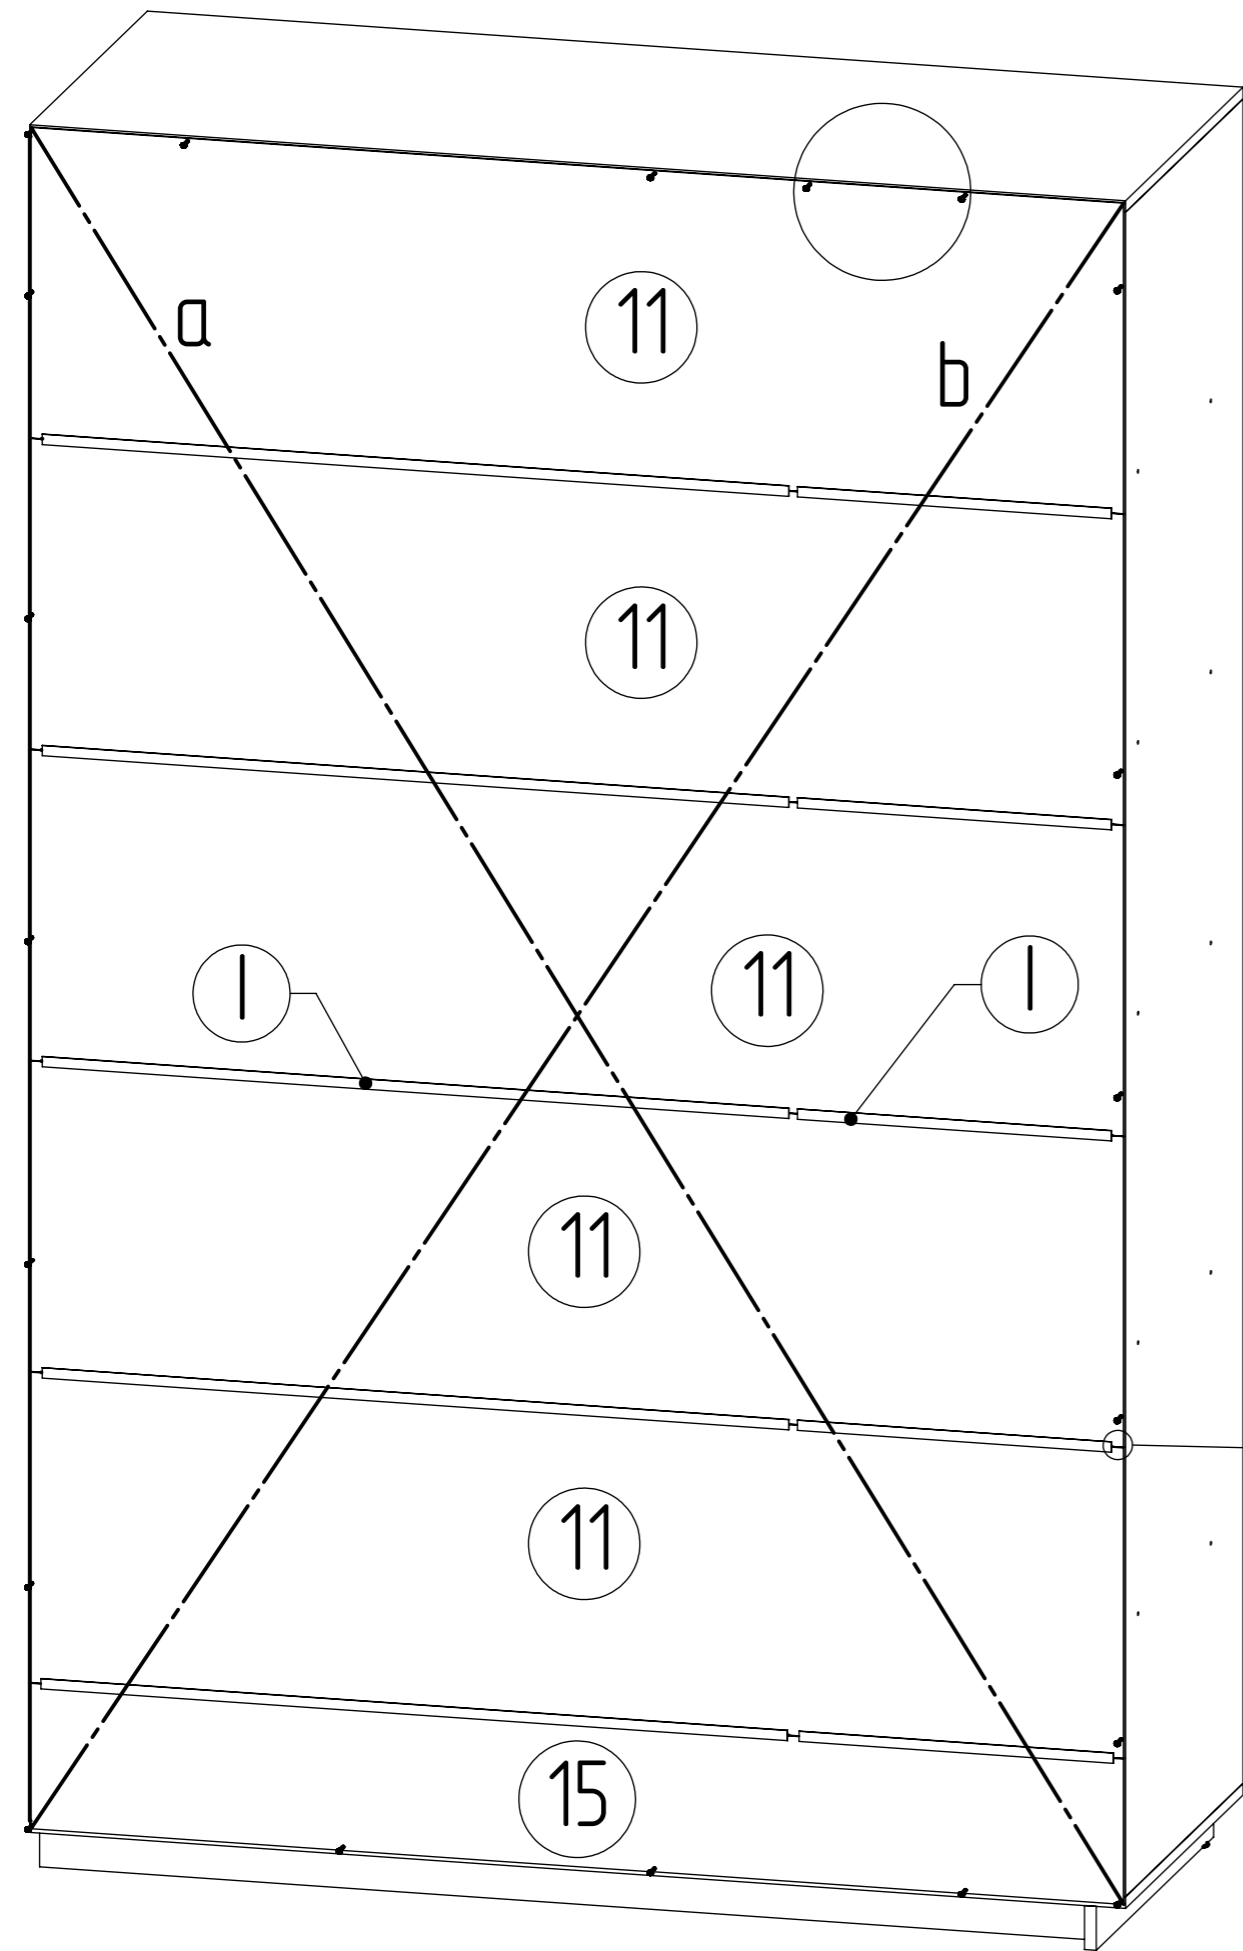


X2





8

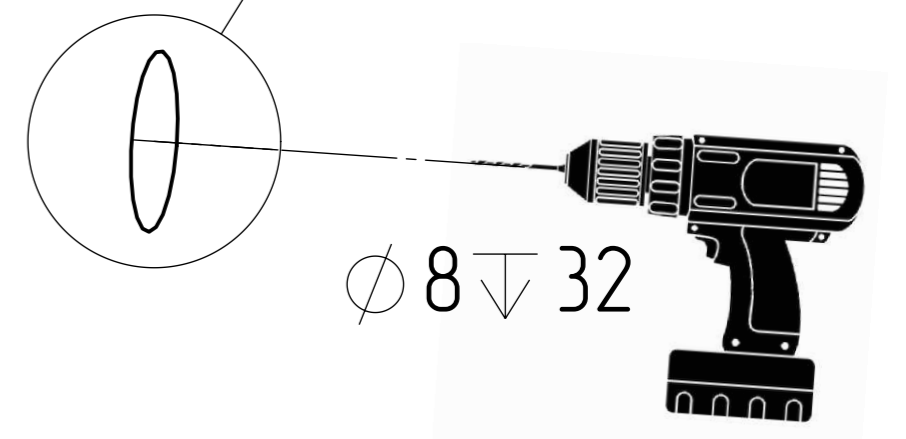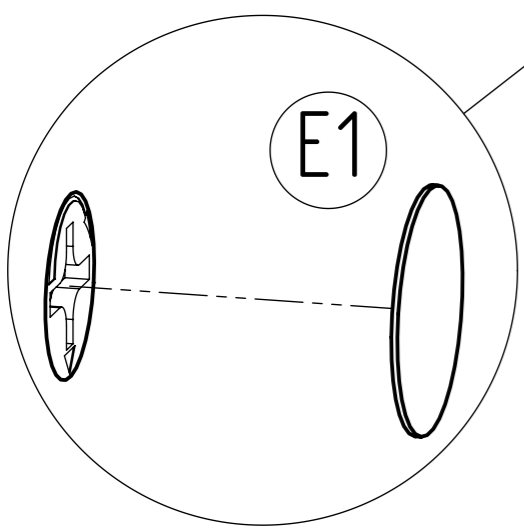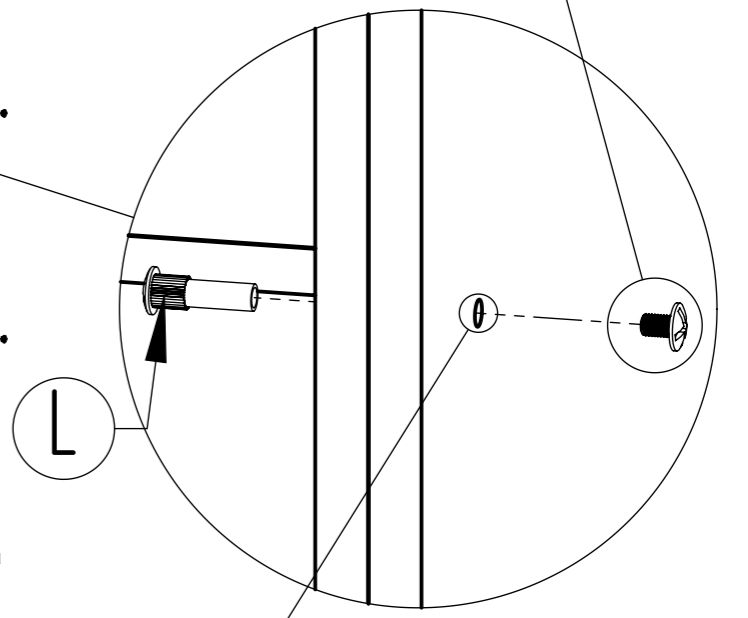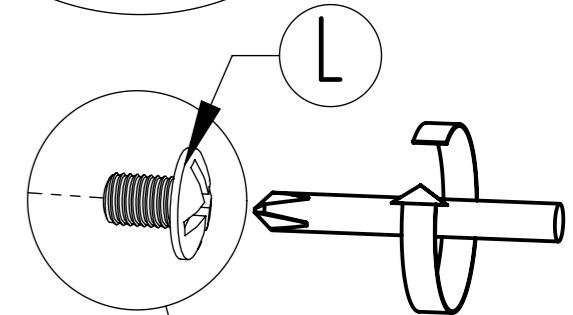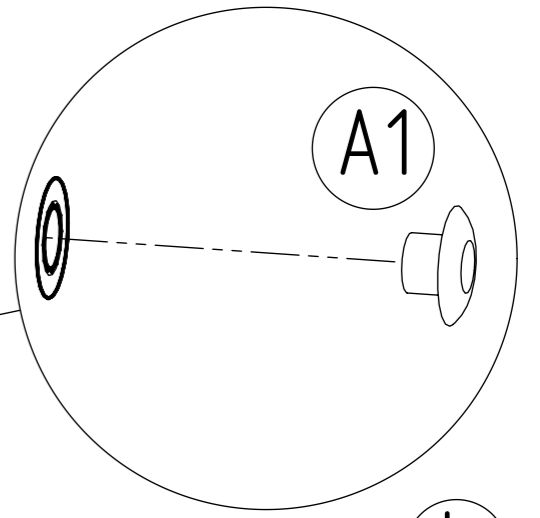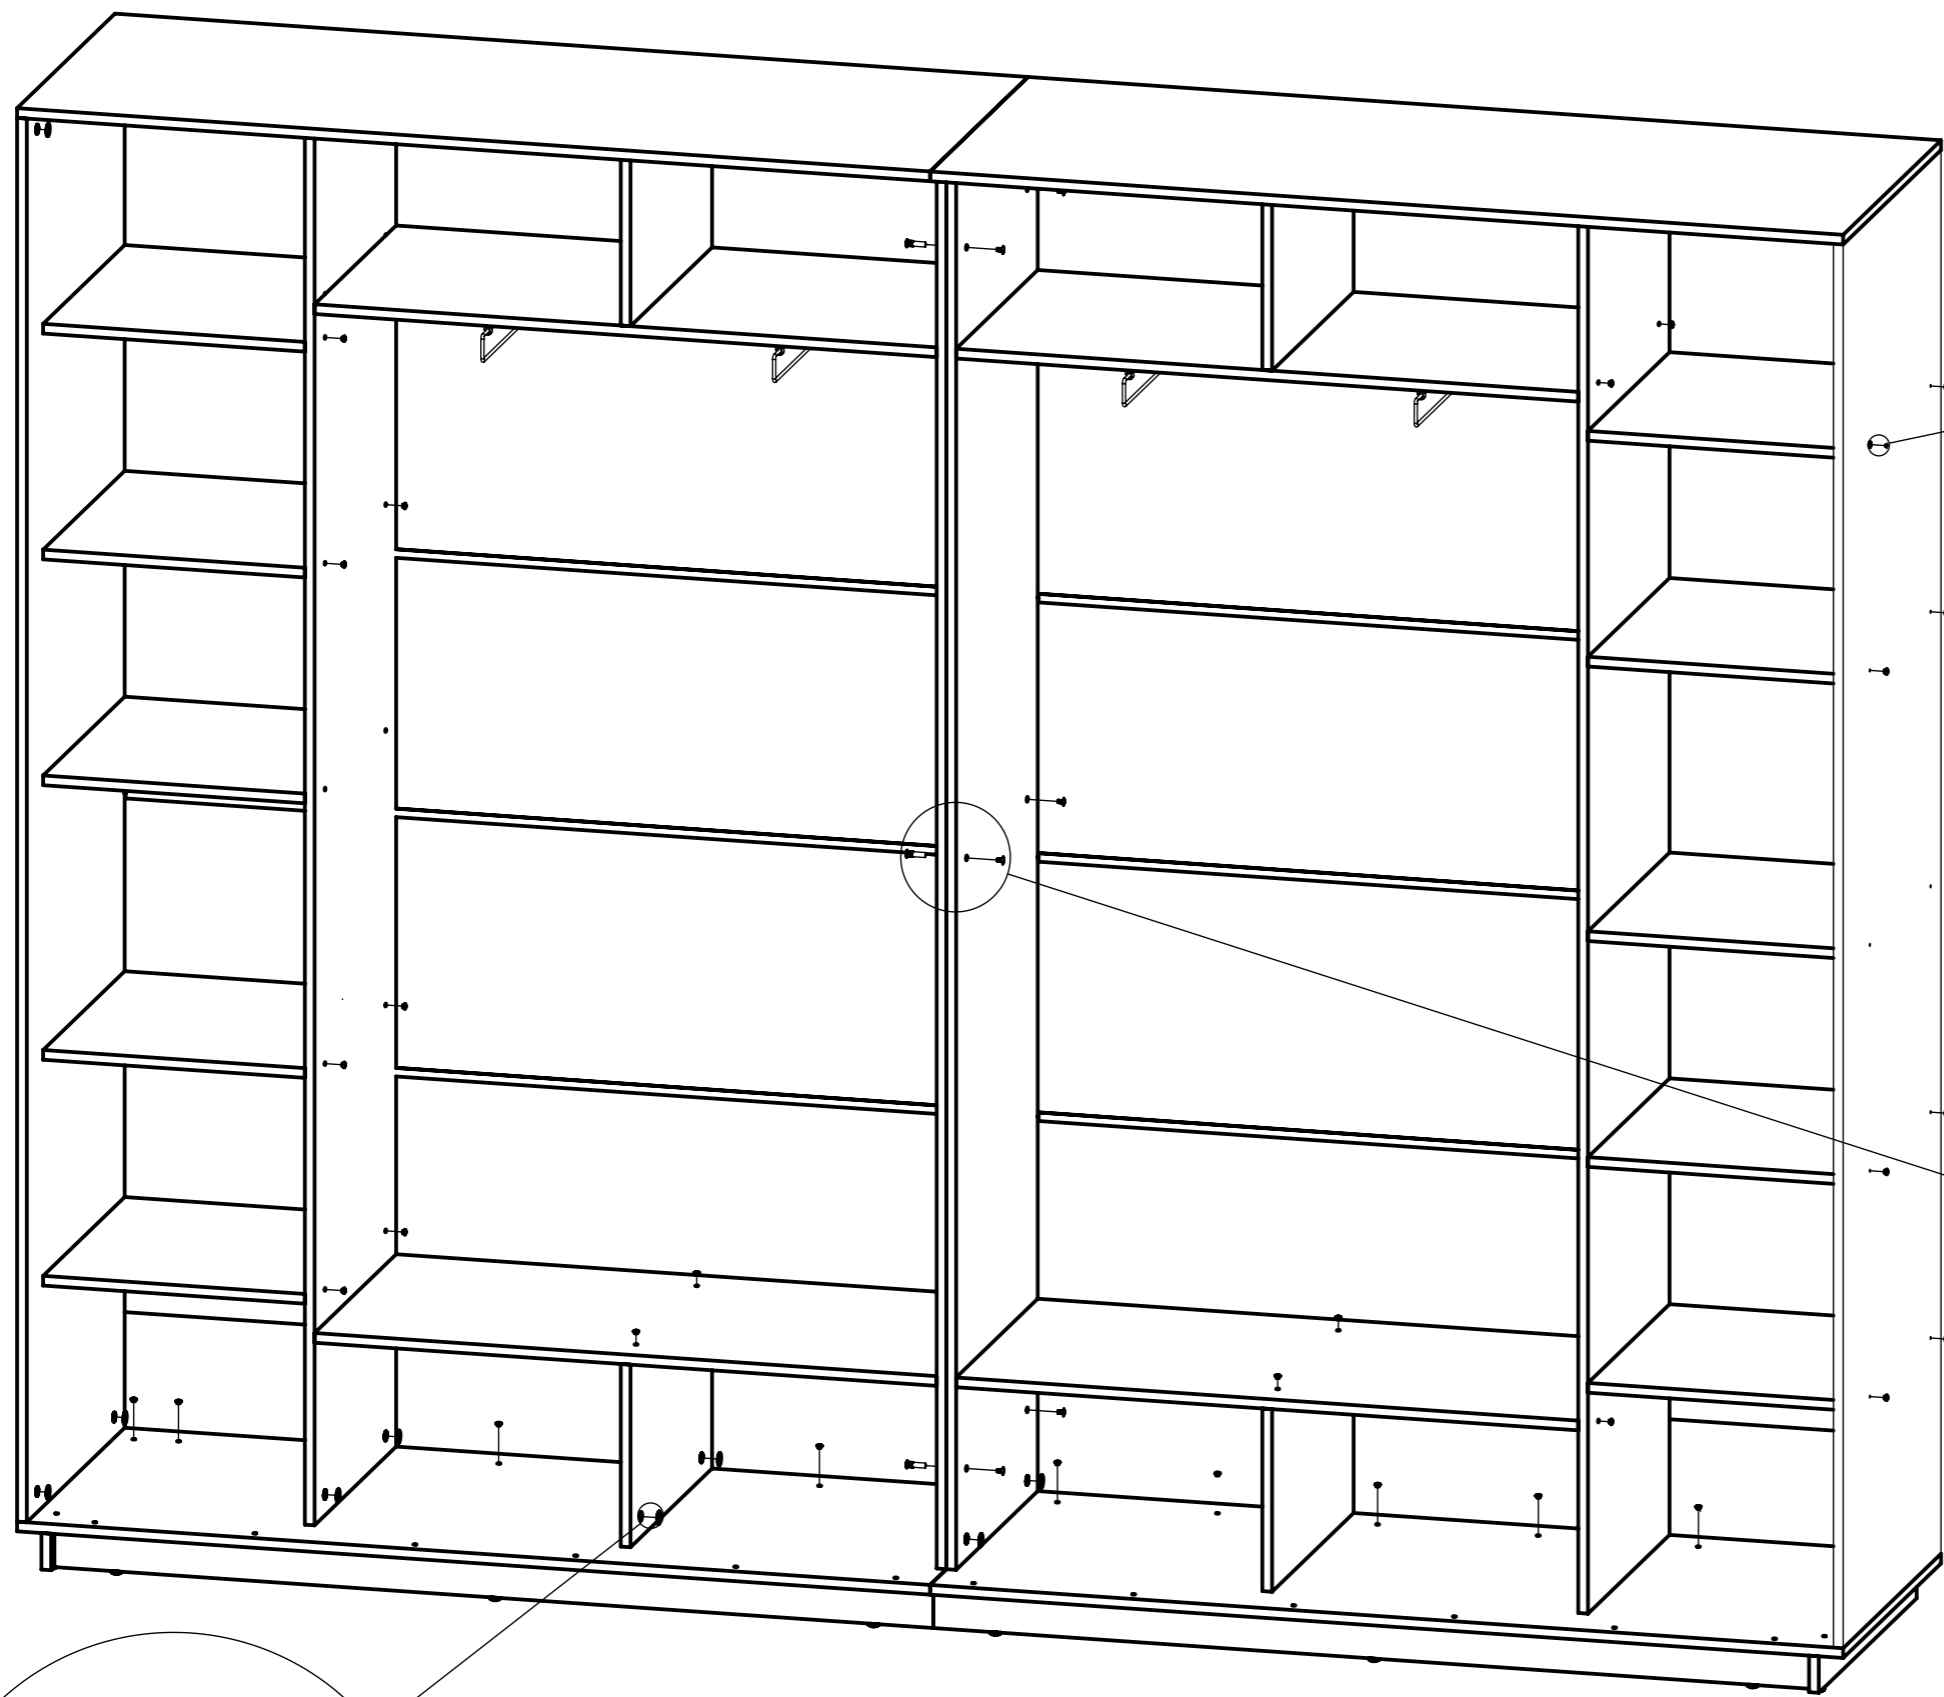


9

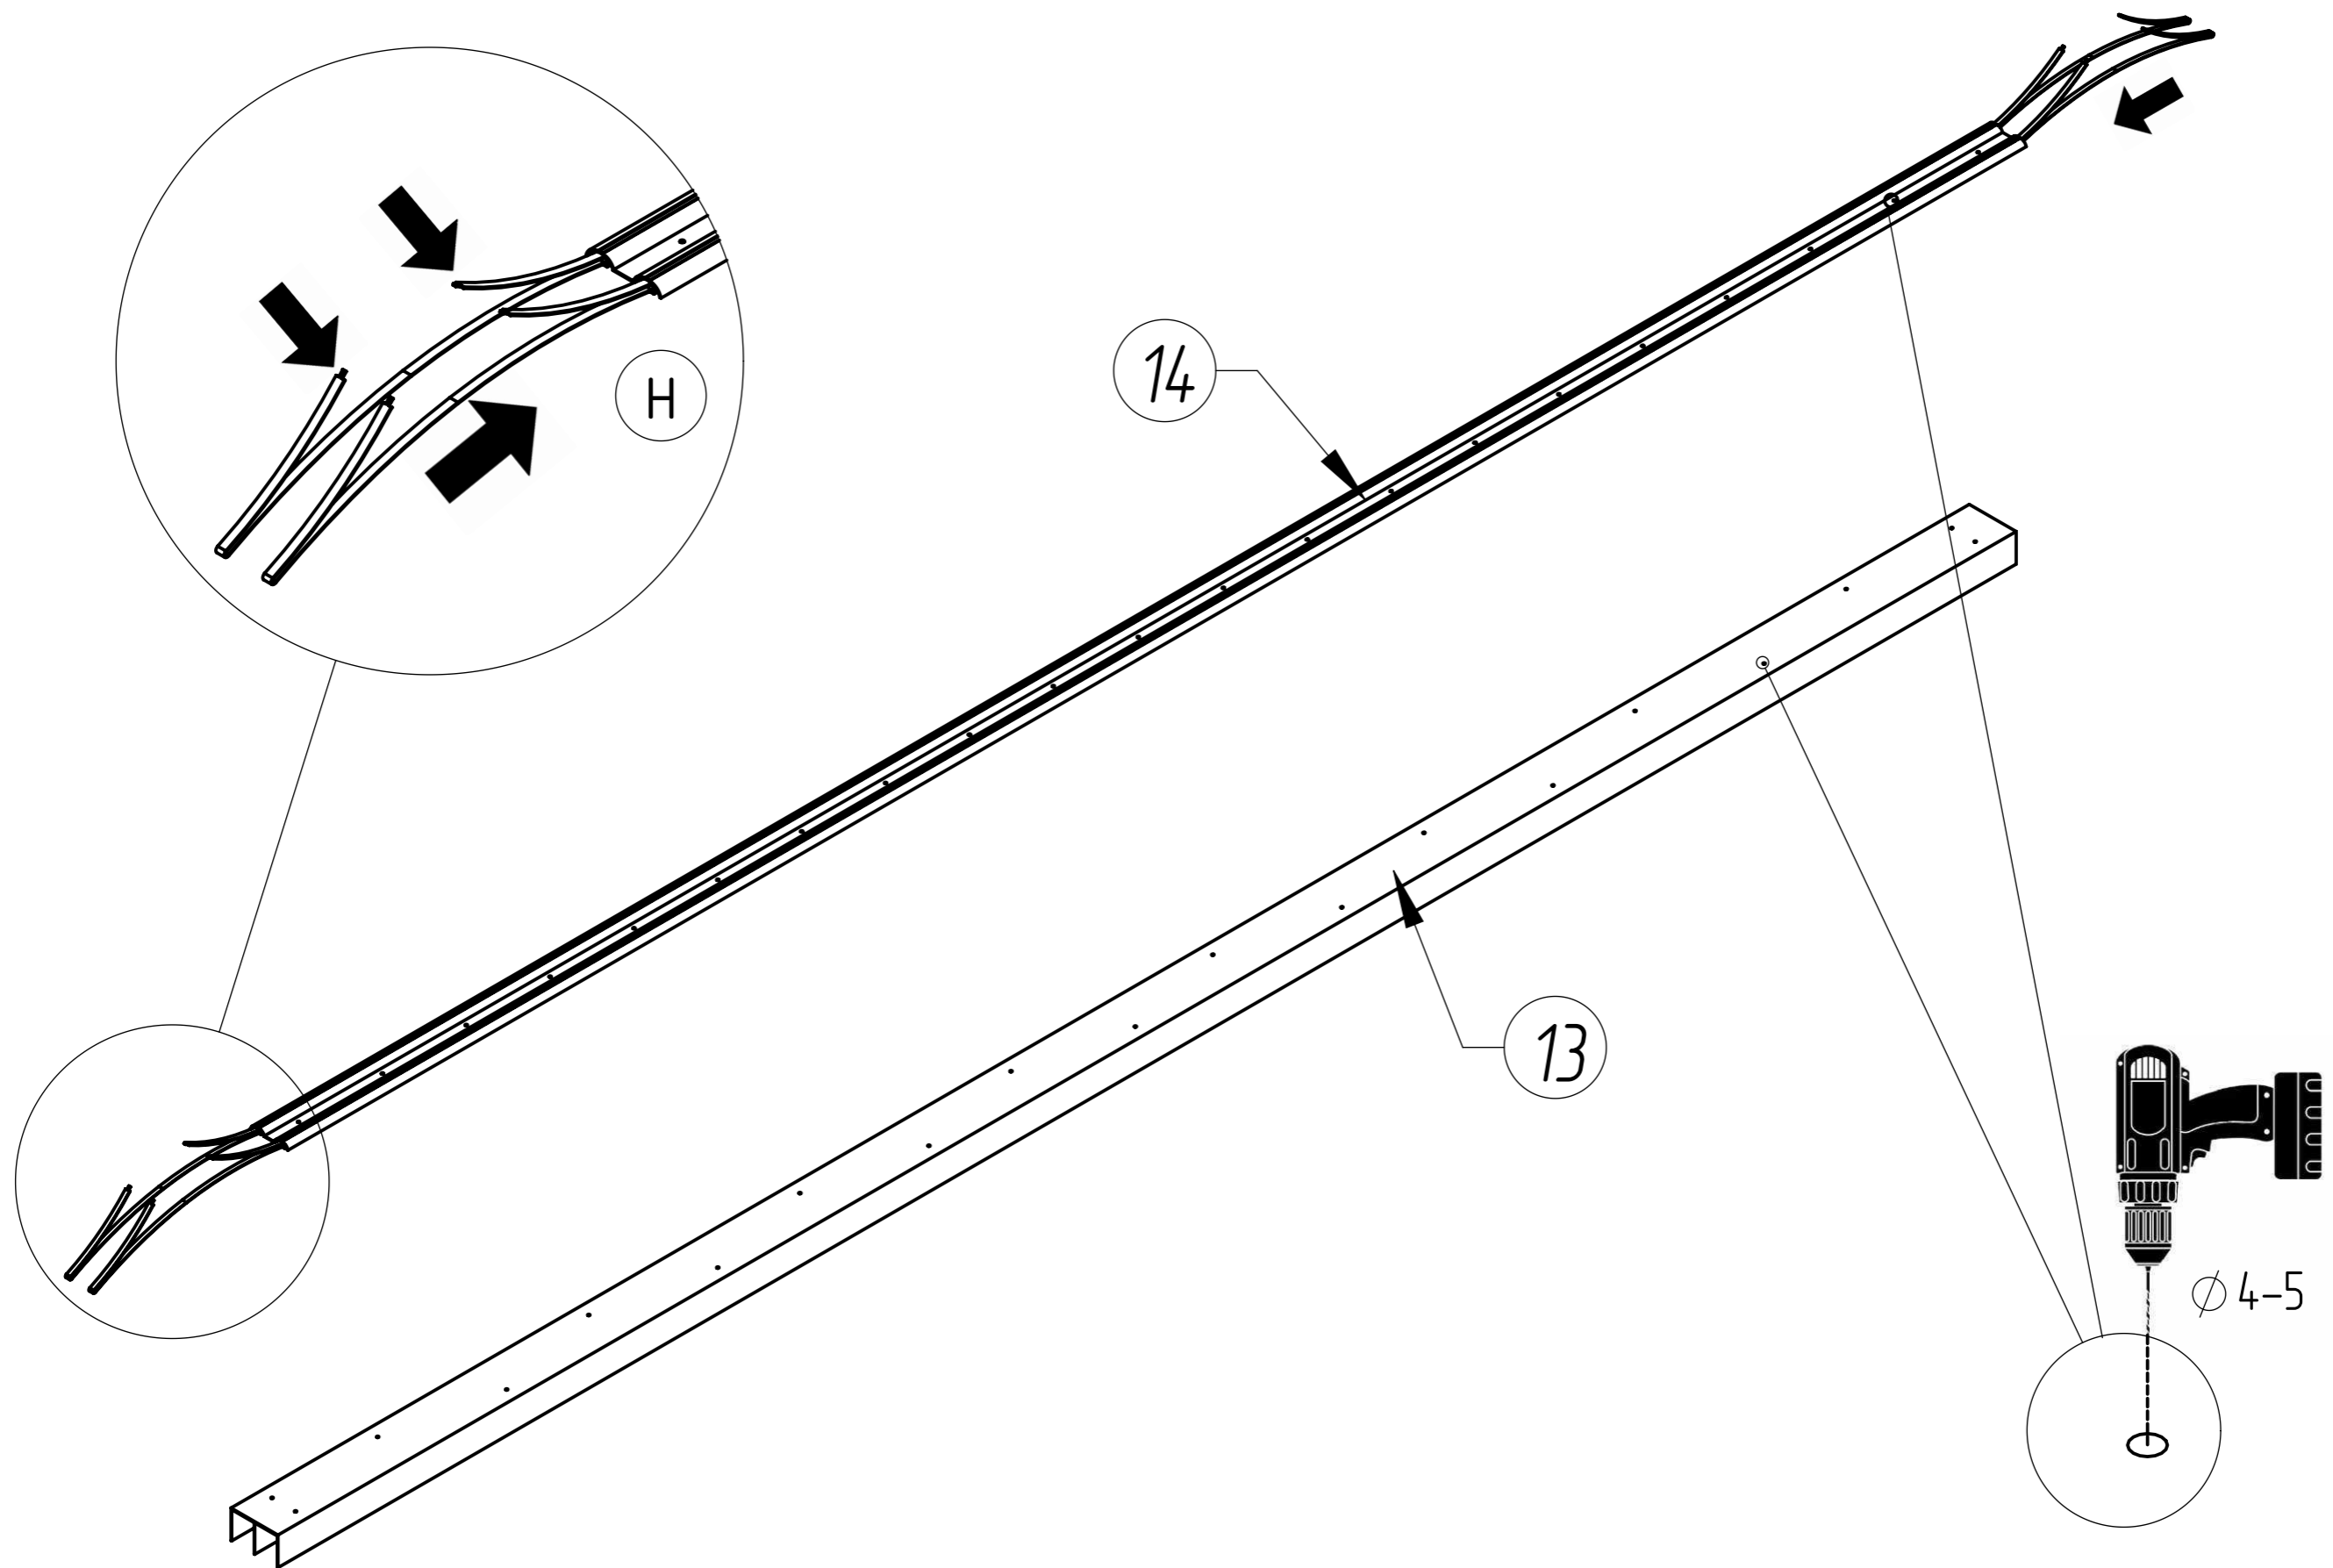

# 10

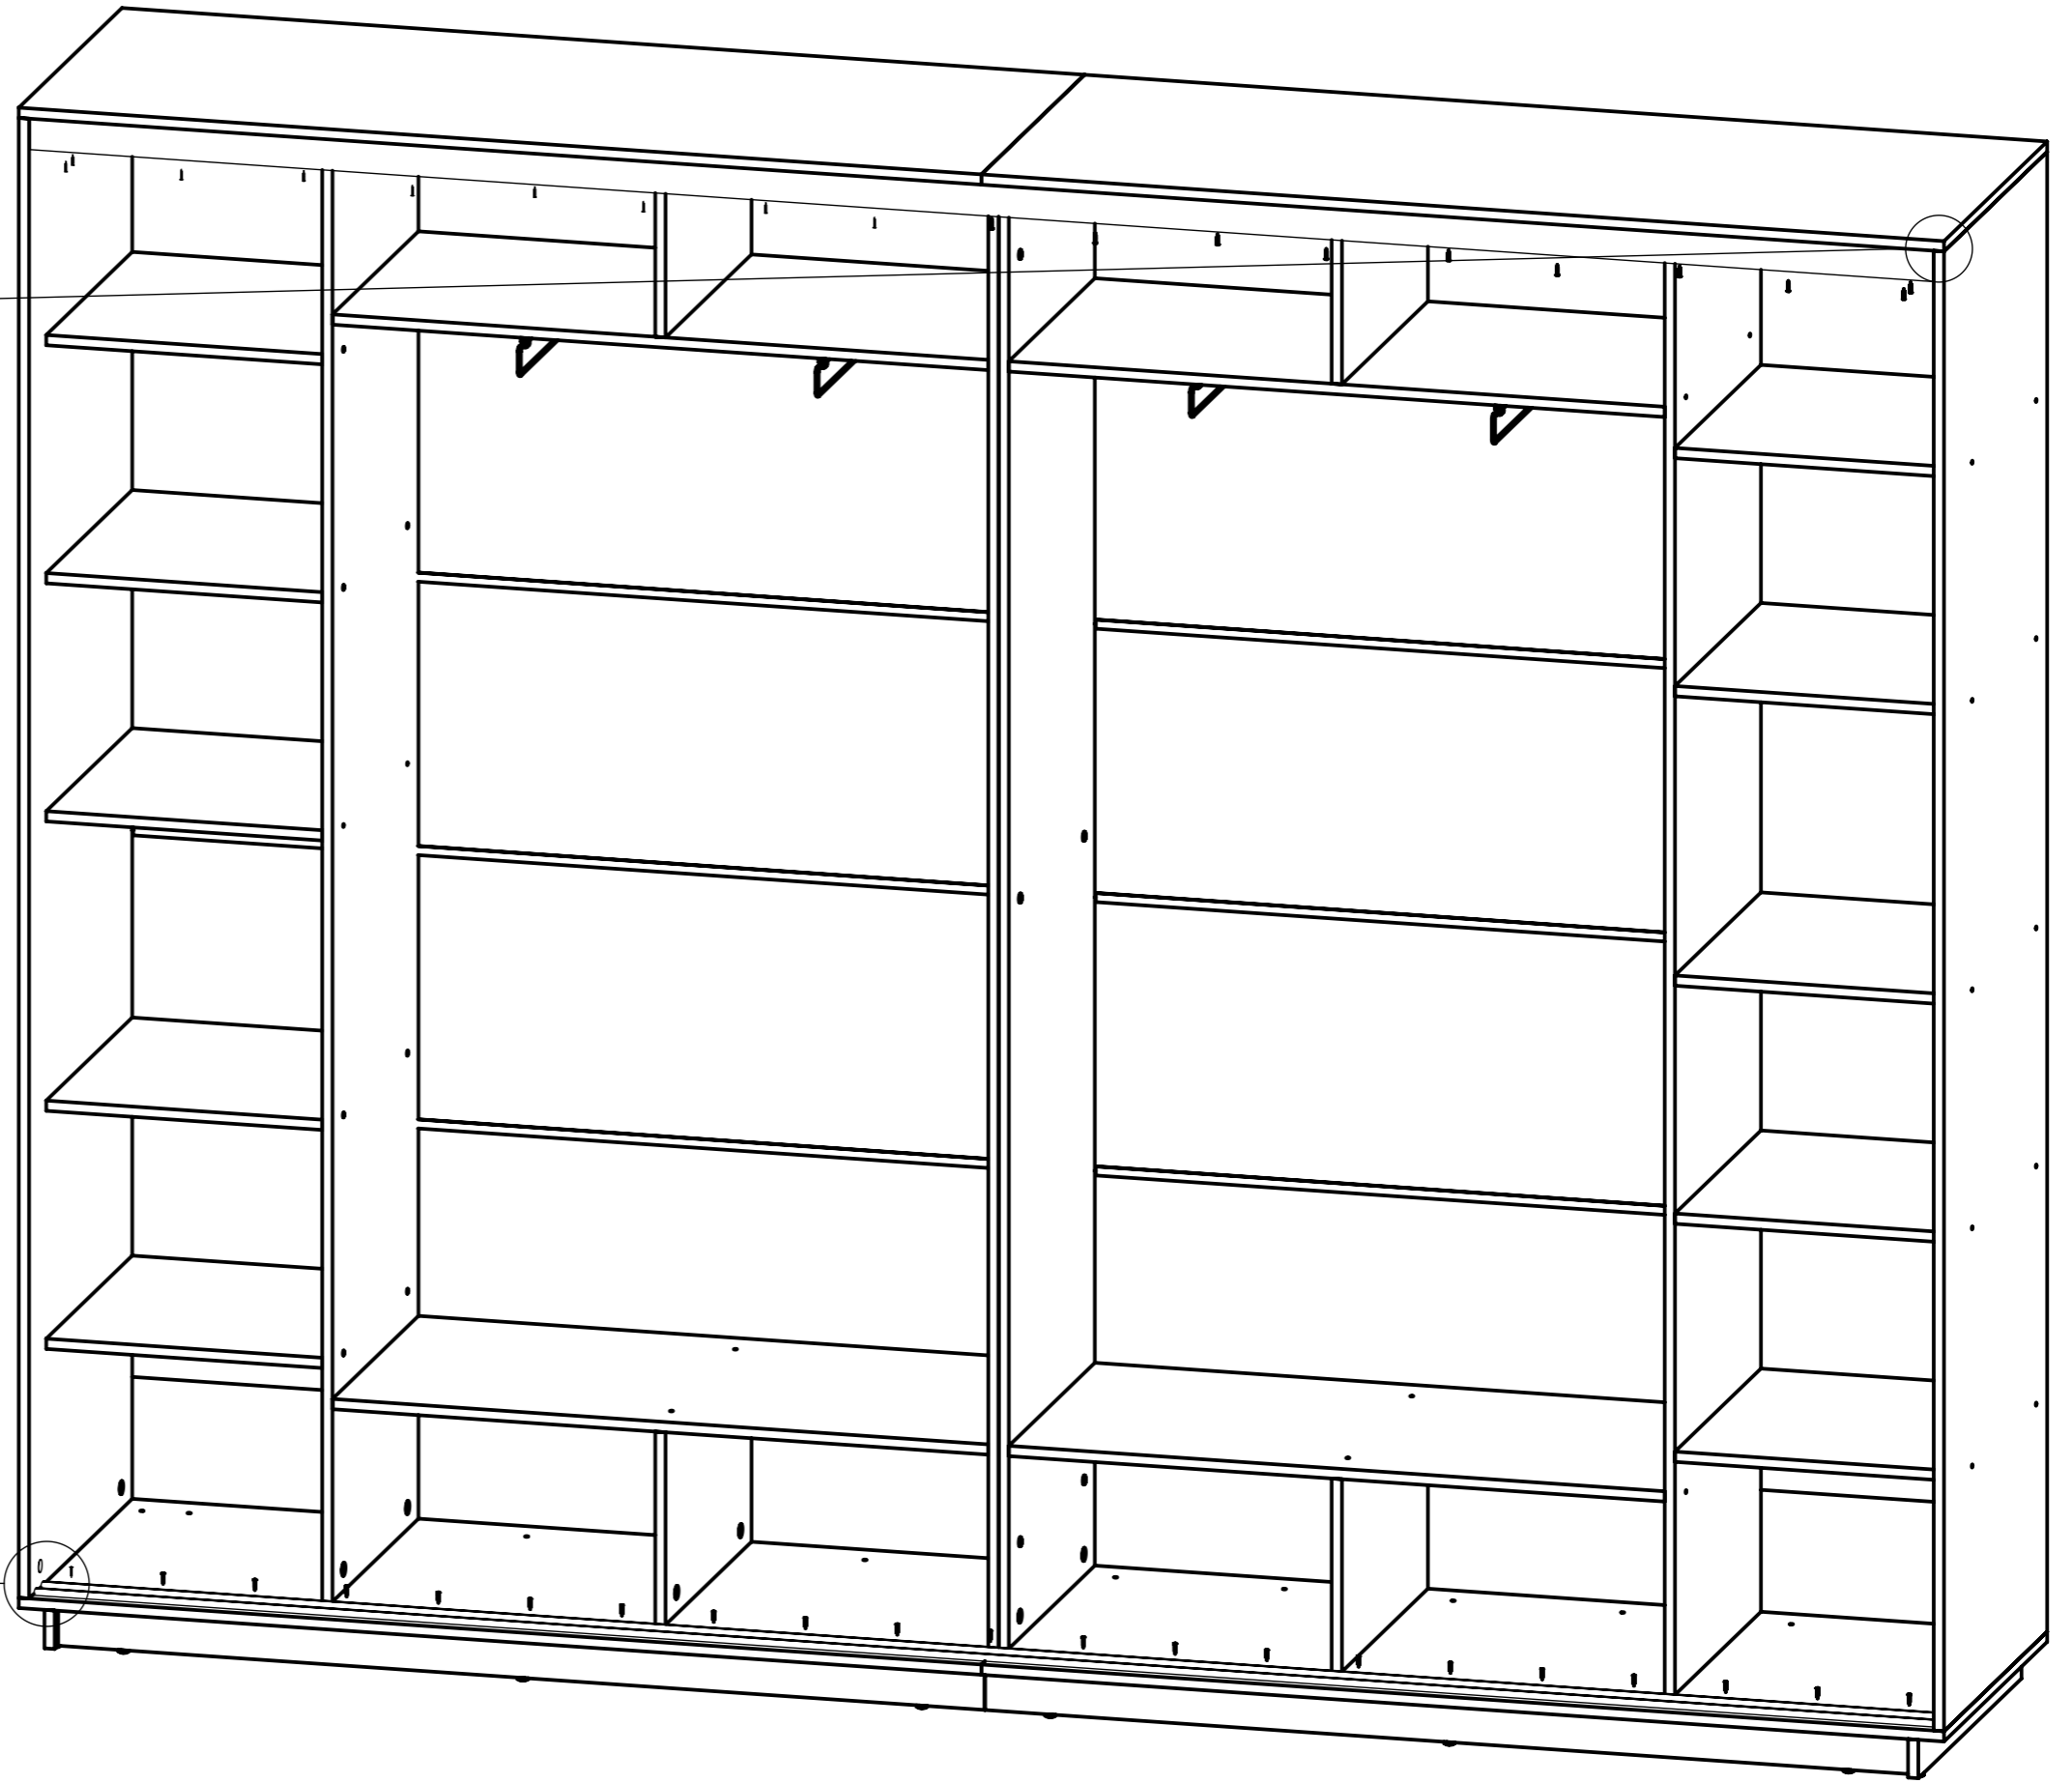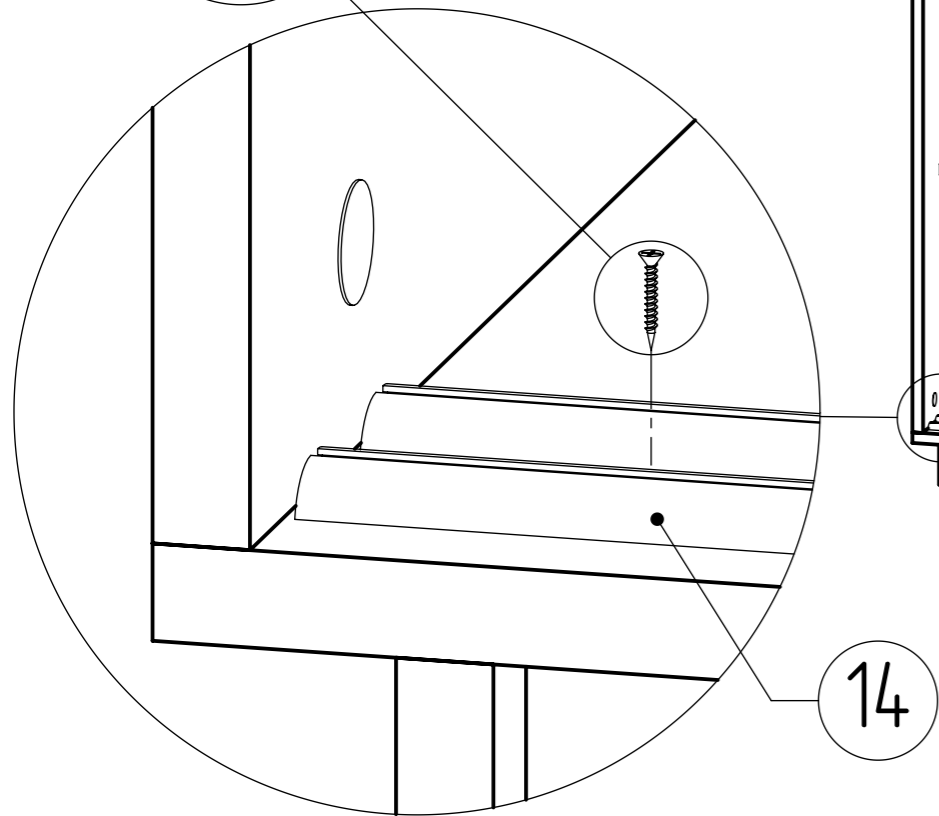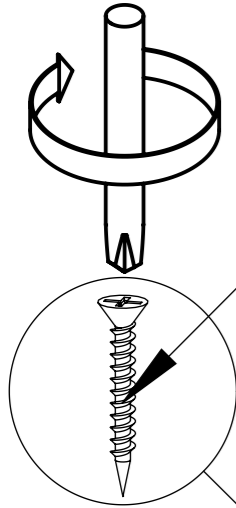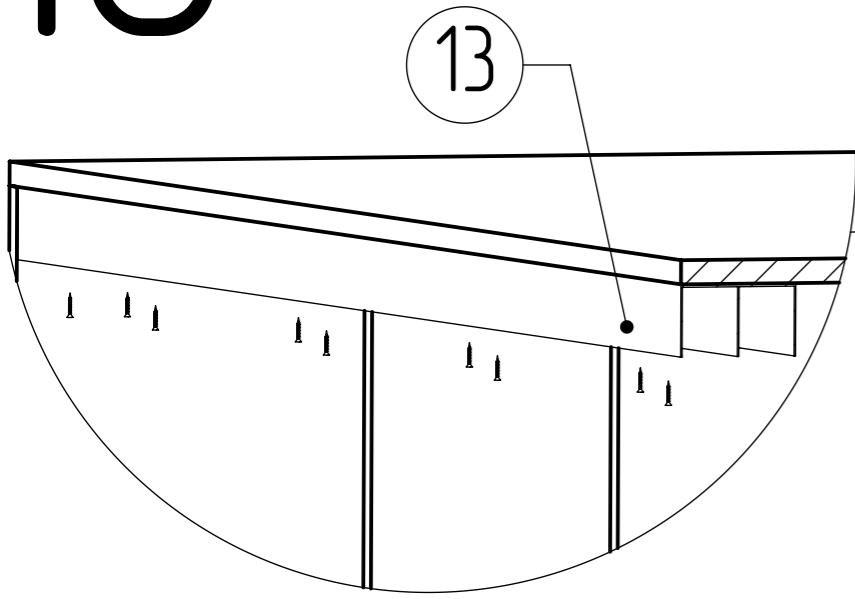

11

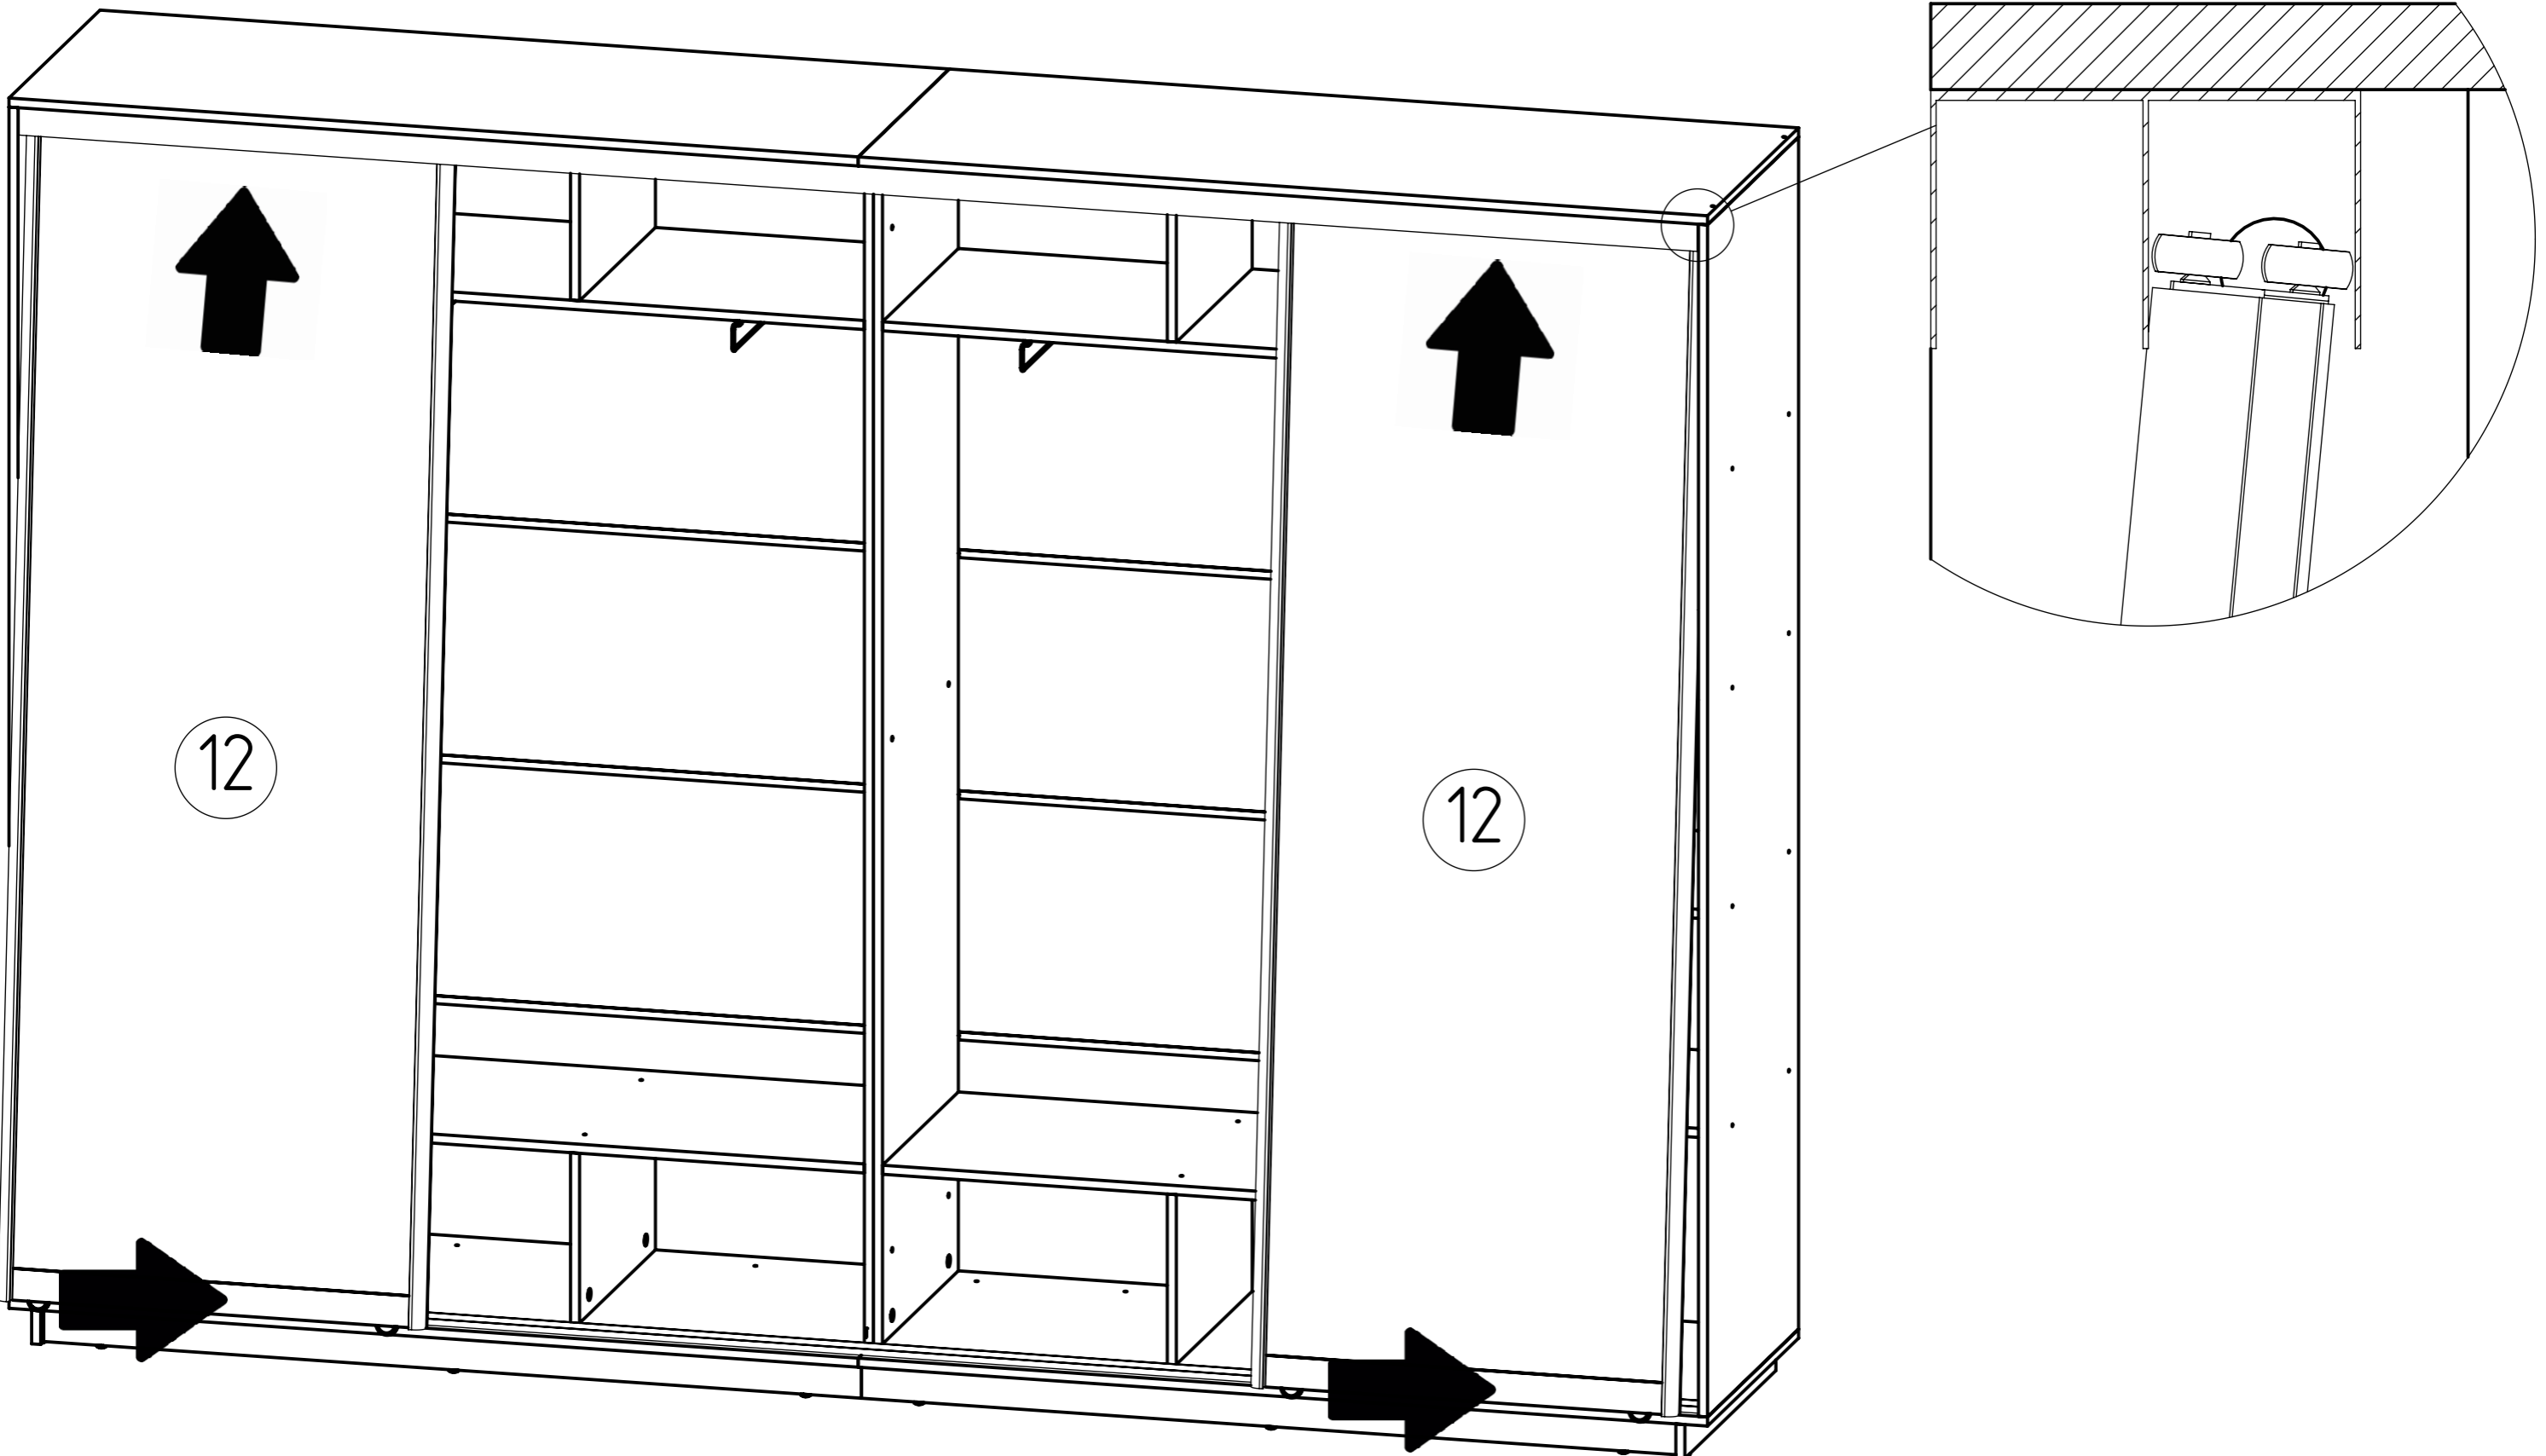

12

